

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 South First, Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30-025-20963
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. NM-880620
7. Lease Name or Unit Agreement Name: M. B. Weir "B"
8. Well No. #9
9. Pool name or Wildcat Skaggs-Drinkard
10. Elevation (Show whether DR, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
Oil Well ☒ Gas Well ☐ Other ☐
2. Name of Operator
Texaco Exploration & Production, Inc.
3. Address of Operator
P. O. Box 3109, Midland, TX 79702
4. Well Location

Unit Letter O : 660 feet from the South line and 2180 feet from the East line
Section 12 Township 20S Range 37E NMPM Lea County

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER: <input type="checkbox"/>	OTHER: <input type="checkbox"/>

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- Tbg stuck, cut Tbg @ 5800' (East string-Skaggs-Drinkard) Sqz Csg 6600'-2650' w/105 Sx Tag Cmt @ 2818' (Ok w/OCD)
- Tag fill @ 5050 (West -String-Skaggs-Drinkard) fill 2 7/8 Csg w/60 Sx 5050'-2650' WOC. Tag @ 2593'
- Cut 2 7/8 Csg on East side, unable to pull Sqz cut w/60 Sx 2650'-2400' (B-Salt) Tag @ 2345'
- Fill 2 7/8 Csg on West side 2593'-1500' w/25 Sx
- Cut both Csg @ 1500' spot 75 Sx plug 1500'-1300' (8 5/8 shoe, T-Salt) Tag @ 1278'
- Circ MLF, 9.5# Brine w/25# gel P/BBL
- Circ Cmt 130' to Surf w/15 Sx. Install dry hole marker. 7/10/01

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Poly Abalos TITLE MANAGER DATE 7/10/01
(This space for State use) POLY ABALOS Telephone No. 683-4996

APPROVED BY [Signature] TITLE Ad Rep DATE 10-23-01
Conditions of approval, if any:

GWW