

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State ☐ Fee ☒

5. State Oil & Gas Lease No.
-

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO RE-ENTER OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR PERMIT - 47 (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER	7. Unit Agreement Name -
2. Name of Operator TEXACO Inc.	8. Form or Lease Name L. R. Kershaw
3. Address of Operator P. O. Box 728, Hobbs, New Mexico 88240	9. Well No. 11
4. Location of Well UNIT LETTER E 1654 FEET FROM THE North LINE AND 990 FEET FROM THE West LINE, SECTION 13 TOWNSHIP 20-S RANGE 37-E NE. 1/4.	10. Field and Pool, or Whelan Monument Tubb
11. Elevation (Show whether DF, RT, GR, etc.) 3566' (DF)	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPER. ☐	PLUG AND ABANDONMENT ☐
FULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	

17. Describe proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1105.

1. Rigged up.
2. Set CIBP in Blinbry Zone @ 5700' & spot 37' cement on plug. Blinbry perms 5753-5890'. P&A, 7-11-80.
3. Perforate abandoned Blinbry string in Yates Zone w/2 JSPF @ 3631', 39', 44', 49', 60', 70', 80', 92', 3700', 04', 15' & 3724'.
4. Set pkr @ 3562'. Acidize Eumont Yates perms 3631-3724' w/2000 gals 15% MCA acid & 48 ball sealers.
5. Frac Eumont perms 3631-3724' w/16,000 gals Vers gel, 4000 gals CO2 & 17,500# 20/40 sand.
6. Set CIBP in Tubb Zone @ 6470' w/2' cement on top of plug. Log zone.
7. Perforate Tubb Zone w/2 JSPF @ 6370', 82', 91', 6407', 14', 20', 26', 36', 44', & 6458'.
8. Set pkr @ 6300'. Acidize perms 6370-6458' w/5000 gals 15% NEFE acid in 3 stages using 700# rock salt between stages.
9. Install pumping equipment. Test and place Tubb Zone on production. Yates Zone Shut-In.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED TITLE Asst. District Supt. DATE 9-30-80

APPROVED BY Orla Stood by TITLE DATE

CONDITIONS OF APPROVAL, IF ANY: