

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

811 South First, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-63

Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>	WELL API NO. 30-025-21426
2. Name of Operator Texaco Exploration & Production, Inc.	5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
3. Address of Operator P. O. Box 3109, Midland, TX 79702	6. State Oil & Gas Lease No. NM 880140
4. Well Location Unit Letter <u>J</u> : 1980 feet from the <u>South</u> line and <u>2307</u> feet from the <u>East</u> line Section <u>11</u> Township <u>20S</u> Range <u>37E</u> NMPM <u>Lea</u> County	7. Lease Name or Unit Agreement Name: C. H. Weir "B"
8. Well No. #7	
9. Pool name or Wildcat Skaggs-Drinkard	
10. Elevation (Show whether DR, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

- PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

- REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

- Set 2 7/8 CIBP on East-String @ 6400' (Drinkard) fill 2 7/8 Csg w/90 Sx plug 6400'-2900' Tag @ 3165 ok w/OCD
- RIH w/Tbg on North-Side Tag CIBP @ 3566' (Glrta) Drill out CIBP Tag Cmt @ 4996' fill 2 7/8 Csg w/30 Sx 4996'-3800' Tag @ 3835' ok w/OCD
- RIH Tag TOC @ 3125 West-String (Tubb) fill 2 7/8 Csg w/40 Sx plug 3125'-1500' Tag @ 1525 ok w/OCD
- R/U on North-String Sqz old Perfs (3602-3700) Sqz Perf 3600'-1500' w/100 Sx (Queen) Tag @ 1522 ok w/OCD
- Perf 6 holes on East Side @ 2900' unable to Sqz spot 35 Sx 3165-1500 (Yates-B-Salt)
- Cut all Csg @ 1500' displace hole w/MLF 9.5 # Brine Gel P/BBL
- Spot 100 Sx plug 1500-1200 (9 5/8 T-Salt) Tag @ 1455 respot 85 Sx 1455-1200 Tag 1323 Respot 50 Sx 1323-1200 ok w/OCD
- Circ Cmt 30' to Surf w/15 Sx Install Dry hole marker. 7/25/01

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Jimmy Bagley TITLE MANAGER DATE 7/25/01

Type or print name Jimmy BAGLEY Telephone No. 915-6834996
(This space for State use)

APPROVED BY [Signature] TITLE Field Rep DATE 7-30-02
Conditions of approval, if any

GW