

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Mobil Oil Corporation	8. Farm or Lease Name E. O. Carson
3. Address of Operator Box 633, Midland, Texas 79701	9. Well No. 23
4. Location of Well UNIT LETTER <u>G</u> , <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>2640</u> FEET FROM THE <u>West</u> LINE, SECTION <u>33</u> TOWNSHIP <u>21-S</u> RANGE <u>37-E</u> N.M.P.M.	10. Field and Pool, or Wildcat Eunice (San Andres)
15. Elevation (Show whether DF, RT, GR, etc.) 3459 GR	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

## Plug and Abandon as Procedures Below:

1. Kill well with 10 ppg salt water.
2. Pull 2" tubing, sweet packer and hold down (set in 1961 w/8000# wt.)
3. Run CIBP on tubing and set in 7" 20#.
4. Spot 250' cement (65sx) on top of CIBP & circ. hole to mud w/25 sx gel/100 bbl.
5. If possible---
  - A. Shoot off 7", 20# casing at 450<sup>±</sup> and pull for salvage.
  - B. Spot 100' plug across stub of 7" (50' above & 50' below stub) w/25 sx cement.
6. Spot 10' plug at surface w/7 sx cement.
7. Erect monument and clear location.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.		
SIGNED <u>[Signature]</u>	TITLE <u>Authorized Agent</u>	DATE <u>5-23-74</u>
APPROVED BY _____	TITLE _____	DATE _____
CONDITIONS OF APPROVAL, IF ANY:		