

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-21774
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☐ GAS WELL ☐ OTHER Water Supply Well

2. Name of Operator
Clayton W. Williams, Jr., Inc.

3. Address of Operator
Six Desta Drive, Suite 3000 Midland, Texas 79705

4. Well Location
Unit Letter A : 890 Feet From The North Line and 990 Feet From The East Line

Section 9 Township 22S Range 36E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
GL - 3571'

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

WORK WILL COMMENCE UPON OCD APPROVAL

- 1) CIBP set @ 3880' w/35' cement on top 9/15/92.
- 2) Circulate 10 PPG gelled brine from CIBP to surface.
- 3) Run Freepoint on 5-1/2" casing. Cut and pull 5-1/2" csg as deep as possible.
- 4) Spot 40 sx balanced cement plug from 1415 - 1565' and a 25 sx plug from 3' - 103'.
- 5) Cut 8-5/8" casing 3' below GL. Set P & A marker. Cut Deadmen. Clear location of all junk.
PLUG AND ABANDON WELLBORE.

SEE ATTACHED WELLBORE DIAGRAM

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE David Grafe TITLE Petroleum Engineer DATE 02/18/93

TYPE OR PRINT NAME David Grafe TELEPHONE NO. 682-6324

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ DATE FEB 22 1993

CONDITIONS OF APPROVAL, IF ANY: