

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
2040 Pacheco St.
Santa Fe, NM 87505

WELL / API NO.	30-025-23016
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
BC & D OIL AND GAS CORP.

3. Address of Operator
P.O. Box 1680, Hobbs, NM 88241

4. Well Location
Unit Letter N : 660 Feet From The south Line and 1980 Feet From The east Line

Section 18 Township 21S Range 38E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

7. Lease Name or Unit Agreement Name

Mark Owens

8. Well No.

1

9. Pool name or Wildcat

Wantz ABO

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MARK OWENS #1 P & A PROCEDURE

7/12/2003

MIRU plugging equipment, TIH w/ 2 7/8" tbgs. & CIBP.
Crew to location, conduct safety meeting, set CIBP @ 7110' and cap w/ 25' cement, POOH w/ tbgs., rig up wireline truck, cut csg. @ 4100', SDFN.

Crew to location, conduct safety meeting, rig up to pull csg., could not, TIH w/ csg. cutter, cut csg @ 850' from surface, TIH w/ 2 7/8" tbgs. to 4150', mix and pump 35' sxs cmt, POOH w/ 20 stands tbgs, SDFN.

Crew to location, conduct safety meeting, TIH w/ tbgs, tag TOC @ 4024', POOH w/ tbgs to 900', mix and pump 60 sxs cmt @ 900' (50' inside 7" casing stub) POH w/ tbgs., SD, WOC, TIH w/ tbgs, tag TOC @ 805, POH w/ tbgs, mix and pump surface plug, cut well head off, rig down, install P & A marker, well plugged.

NOTE: All activity witnessed by NMOCID inspector.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Dannie Hill TITLE President DATE 12/9/2003
TYPE OR PRINT NAME Dannie Hill TELEPHONE NO. 505-397-2972

APPROVED BY [Signature] TITLE Field Rep DATE 2-13-03
CONDITIONS OF APPROVAL, IF ANY:

GWW

IC