

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLY
(Other instructions
verse side)7E*
re-Form approved.
Budget Bureau No. 42-K1424.

5. LEASE DESIGNATION AND SERIAL NO.

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR TEASE NAME

9. WELL NO.

10. FIELD AND POOL, OR WILDCAT

11. SEC. T. R. M. OR BLK. AND
SURVEY OR AREA

12. COUNTY OR PARISH 13. STATE

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. ☐ OIL
WELL ☐ GAS
WELL ☐ OTHER

2. NAME OF OPERATOR

3. ADDRESS OF OPERATOR

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☐(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any
proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones perti-
nent to this work.) *

Above well plugged & abandoned as follows:

4-26-54

1. Set Great Iron Bridge plug at 6000' & dumped 35' cement to 5965'
2. Set Great Iron Bridge plug at 4200' & dumped 35' cement to 4165'
3. Set 25 cu cement plug inside 7" casing from 2913' to 2900'.
4. Set 1" csg. & 1782' 1/13' 1490' Recovered csg from 1413'
5. Set 50 cu cement plug in and out of 7" csg from 1705' to 1430'.
6. Set 50 cu cement plug in and out of 9-5/8" from 911' to 770'.
7. Set 50 cu cement plug from 10' to surface & installed dry hole marker.

Tubing was run and vent was placed between all plugs.
Location cleaned & ready for final inspection

18. I hereby certify that the foregoing is true and correct

SIGNED

Gene Mierford

TITLE

Agent

DATE

22 May 1954

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

*See Instructions on Reverse Side

JUN 10 1954
ARTHUR R. L. SMITH
DISTRICT ENGINEER