

Static A" Ale 2 32 Cont.

7. Swab back load and evaluate FE. Lwr pkr through perfs. POH w/WS and pkr.
8. Plug back w/sd to 3790 w/WL dump bailer.
9. RIH w/pkr on WS. Spot 2 bbl 15% NEFE 3782-3656. PUH and set pkr at 3600. Trap 500 psi on csg. Acdz perfs 3702-3782 w/3000 gals 15% NEFE. Drop 27 RCN bal sealers spaced wvenly throughout. Pump at 4-5 BPM.
10. Swab back load and evaluate FE. Lwr pkr through perfs. POH w/WS and pkr.
11. CO hole to PBTD 3870 by rev. Circ if possible or w/Hydrostatic bailer.
12. RIH w/2-3/8 production tbg and 1-1/2" pump on 66 rod string. TS 3860 SN 3830. POP.

RECEIVED

MAY 18 1984

OC  
HOBBS OFFICE