

DISTRICT I

1625 N. French Dr., Hobbs, NM 88240

DISTRICT II

811 South First, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

DISTRICT IV

2040 South Pacheco, Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources**OIL CONSERVATION DIVISION**

2040 South Pacheco

Santa Fe, NM 87505

FORM C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL APINO. 30-025-25030
1. Type of Well: <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER		5. Indicate Type of Lease <input type="checkbox"/> STATE <input checked="" type="checkbox"/> FEE
2. Name of Operator Apache Corporation		6. State Oil & Gas Lease No.
3. Address of Operator 2000 Post Oak Blvd., Ste. 100, Houston, Texas 77056-4400		7. Lease Name or Unit Agreement Name Gill Deep
4. Well Location Unit Letter M : 720 Feet From The South Line and 720 Feet From The West Line Section 31 Township 21S Range 37E NMPM Lea County		8. Well No. 1
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3468' GR		9. Pool name or Wildcat Blinebry Oil & Gas

11. NOTICE OF INTENTION TO: <input type="checkbox"/> Perform Remedial Work <input type="checkbox"/> Plug and Abandon <input type="checkbox"/> Temporarily Abandon <input type="checkbox"/> Change Plans <input type="checkbox"/> Pull or Alter Casing <input type="checkbox"/> Other		Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data SUBSEQUENT REPORT OF: <input type="checkbox"/> Remedial Work <input type="checkbox"/> Altering Casing <input type="checkbox"/> Commence Drilling Operations <input type="checkbox"/> Plug and Abandonment <input type="checkbox"/> Casing Test and Cement Job <input checked="" type="checkbox"/> Other Attempt to Re-Activate Tubb & Drinkard and Downhole Commingle w/ Blinebry
--	--	---

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 6/21/2001 MIRU and pull out of hole w/ production equipment. Run in hole w/ retrieving head on 2-7/8" workstring. Tag fill @ 5840'. (RBP set @ 5896' per Collins & Ware records). Attempt to circulate well. Unable to achieve circulation
- 6/22/2001 Rig up foam unit and achieve circulation. Clean out fill to 5861'. Tagged RBP @ 5861'. Attempt to release tool - tool will not release. Retrieving head stuck on RBP
- 6/25/2001 Back off tubing below check valve. Pull out of hole w/ check valve. Run in hole & screw back on tubing. Rig up wireline. Freepoint tubing @ RBP. Back off tubing 1 joint above retrieving head. Pull out of hole w/ 2-7/8" workstring. Run in hole w/ 2 joints weighted pipe w/ jars & sawtooth shoe
- 6/26/2001 Start circulating w/ foam air. Found four tight spots between 5600' & 5860'. Stop @ top of plug & circulate well clean. Pull out of hole w/ weighted pipe & sawtooth shoe. Prep to run bumper sub & jars
- 6/27/2001 Run in hole and screw into joint of tubing. Jar & work RBP for six hours w/ no success.

6/28/2001 Pull out of hole w/ workstring. Run in hole with production equipment and return to production in Blinebry

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Debra J. Anderson TITLE Sr. Engineering Technician DATE 7/31/2001

TYPE OR PRINT NAME Debra J. Anderson TELEPHONE NO. 713-296-6338

(This space for State Use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: _____

RECEIVED
AUG 26 1937
Hobbs
OCD