

**ATTACHMENT TO FORM C-103  
COLLINS & WARE, INC.  
GILL DEEP #3**

**10/20/97** Perf Blinebry with 4" casing gun from 5650' - 5669' (20 holes), and 5570' - 5580' (11 holes). Set 7" RBP at 5727'.

**10/21/97** Set packer at 5620' above perfs 5650' - 5669'. Pump 1000 gals of 15% Ferchek acid with 30 BS. Release RBP and set at 5620' and packer at 5450'. Acidize perfs 5570' - 5580' with 500 gals 15% Ferchek acid with 15 ball sealers. Move RBP to 5780'.

**10/22/97** Set packer at 5401'. Attempt to frac well. Pumped 17,600 gals gel and 2000# sand slug. Screened out well. Attempt second frac. Pumped 16,600 gals gel pad. Started sand and screened out at 3 ppg on formation.

**10/23/97** GIH with 4" guns and perf 1 SPF from 5631' - 5650' and 5580' - 5590'. Perfs now 5631' - 5669' (40 holes) and 5570' - 5590' (22 holes). Acidize perfs 5631' - 69' and 5570' - 90' with 3000 gals 15% Ferchek with 90 ball sealers.

**10/24/97** Frac Blinebry from 5580' - 5650' with 49,600 gals gel and 139,900# 20/40 sand.

**10/29/97** Run 2 3/8" tubing and set packer at 5503' with 10 points tension. Put on production.