Submit 3-Copies to Appropriate District Office

State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

DISTRICT I P.O. Box 1980, Hobbs, NM \$8240

P.O. Box 2088	WELL API NO. 30-025-25130	
Santa Fe, New Mexico 87504-2088	5. Indicate Type of Lance STATE	FEE X
	fi. State Oil & Gas Loses No.	

DISTRICT II P.O. Drawer DD, Artesia, NM 88210 DISTRICT III 1000 Rio Brazos Rd., Azasc, NM 87410		30-023-23130	
		5. Indicate Type of Lesse STATE FEE X	
		6. State Oil & Gas Lesse No.	
(DO NOT USE THIS FORM FOR PROP DIFFERENT RESERV	CES AND REPORTS ON POSALS TO DRILL OR TO DEE POIR. USE "APPLICATION FOI 01) FOR SUCH PROPOSALS.)	EPEN OR PLUG BACK TO R PERMIT"	7. Lesse Name or Unit Agreement Name
1. Type of Well: OIL GAS WELL X WELL	OT I		Mark Owen
2. Name of Operator	OIRE		8. Well No.
Marathon Oil Company			9. Pool sense or Wildox
3. Address of Operator P. O. Box 552, Midland	l. TX 79702		Wantz Abo, Wantz Granite Wash
4. Well Location	Feet From The South		2310 Feet From The West Lin
Section 35	Township 25 2/ 10. Elevation (Show when the control of the control	ether DF, RKB, RT, GR, etc.,	NMPM Lea County
11. Check A			e, Report, or Other Data
	NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRIL	LLING CPNS. DPLUG AND ABANDONMENT
PULL OR ALTER CASING	•	CASING TEST AN	ID CEMENT JOB
OTHER:			nole commingle Wantz Abo w/Wantz [Granite Wash
12. Describe Proposed or Completed Operation work) SEE RULE 1103.	cas (Clearly state all pertinent data	ails, and give pertinent dates,	including estimated date of starting any proposed
			ommingle Wantz Abo and Wantz Grani owing is the procedure:
1. Worked pkr free &	rigged line to fra	c tank. POOH w/	/pkr.
2. Killed well w/16 b	obls lease crude.		
3. RIH w/GR-CCL & per	rf'd 6632'-6896',	7187'-7193' & 73	346'-7366' w/2 JSPF (66 holes).
4. Set RBP @ 4360' & w/RBP. Set RTTS	_	Pumped 1000 ga	als 15% NEFE to pickle tbg. POOH
Acidized Granite V ball sealers.	Wash perfs 7254'-73	66' w/2500 gals	7.5% HCl & 2500 gals CO ₂ & 54
	(See	Attachment 1)	
I hereby certify that the information above is true			
/ # / N // .			
SIGNATURE (ANC A. BA	tweel		ng Technician рат 6-3-91 (915) ТЕЦИТОМ 10. 682-1626

IN UND DRIGHNAL SIGNED BY JERRY SEXTURE DISTRICT I SUPERVISOR

JUN 1 2 1991 __ mus --

CONDITIONS OF AFFROVAL, IF ANY:

MAR

APPROVED BY

ATTACHMENT 1

Item 12 (continued)

- 6. RIH & set RBP @ 7242'. Reset pkr @ 6555' to acidize Wantz Abo 6632'-7218' (53 holes) w/6800 gals 15% HCl & 6800 gals CO₂ & 117 balls for diversion.
- 7. Knock balls off perfs & reset RBP @ 7245'.
- 8. RIH & retrieve ball catcher & RBP. POOH.
- 9. RIH w/2 3/8" J-55 tbg, SN, & tbg anchor to 7352'. Remove BOP. RIH w/1.25" rod pump & sucker rods.
- 10. Placed well on test pumping thru tester.