

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-25443
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. V-3551
7. Lease Name or Unit Agreement Name Northern AKQ State
8. Well No. 1
9. Pool name or Wildcat Rock Lake Bone Spring

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER Plug & Abandon
2. Name of Operator YATES PETROLEUM CORPORATION
3. Address of Operator 105 South 4th St., Artesia, NM 88210
4. Well Location Unit Letter <u>0</u> : <u>660</u> Feet From The <u>South</u> Line and <u>1980</u> Feet From The <u>East</u> Line Section <u>28</u> Township <u>22S</u> Range <u>35E</u> NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)  
3524' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
<b>NOTICE OF INTENTION TO:</b>	<b>SUBSEQUENT REPORT OF:</b>
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to P&A well as follows: Perfs 6286-6522'; 7016-7022'; 8411-8478' - Delaware.

- 1) Contact Paul Kautz 393-6161 and Notify when plugging operations will commence (NMOCD, Hobbs, NM).
- 2) Load hole /salt gel (between plugs)
- 3) Set plug #1 10850-10994' w/50 sx on top of liner and across Bone Springs perfs.
- 4) Set plug #2 7500-7600' across DV tool and above lower perfs.
- 5) Set plug #3 6250-6350' across top of Delaware and top perfs.
- 6) Set plug #4 4320-4570' inside and out of 13-3/8" shoe and 9-5/8" stub (tag this plug).
- 7) Set plug #5 2925-3025' across DV tool inside 13-3/8" casing.
- 8) Set plug #6 from 430-530' across 20# shoe.
- 9) Set plug #7 at surface.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Juanita Goodlett TITLE Production Supervisor DATE 3-23-92  
TYPE OR PRINT NAME Juanita Goodlett

TELEPHONE NO. 505/748-1471

(This space for State Use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

MAR 25