

PROCEDURE - Continued  
NORTHERN NATURAL STATE WELL NO. 1  
Rock Lake (Morrow) Field  
Lea County, New Mexico

Page 2

9. Run 2-7/8" tbg & spot Plug No. 4 - 75 sxs in & out 9-5/8" csg stub & across 13-3/8" csg shoe.
10. Spot Plug No. 5 - 75 sxs 2980-2875' over DV tool.
11. Spot Plug No. 6 - 75 sxs 510-405' across 20' csg shoe.
12. Spot Plug No. 7 - 25 sxs 25' to surface.
13. Cut off well heads. Weld on plate. Install dry hole marker.
14. Clean location & tank battery. Leave well P&A.

MIDLAND DISTRICT DRILLING DEPARTMENT  
7-5-79 JRH:JLW:1b