Form 3160-5	UNITED STATES	N.M. CH.	RORM APPROVED	
(June 1990)	DEPARTMENT OF THE INTERIOR	P.O. E.c.: 1960	Budget Bureau No. 1004-0135	
	BUREAU OF LAND MANAGEMENT	Hobbs, NM C.2	Expires: March 31, 1993 5. Lease Designation and Serial No.	
		STORED BY I CIVIL COM		
	SUNDRY NOTICES AND REPORTS ON W	TELLS	LC 0634580 6. If Indian, Allottee or Tribe Name	
De med une Alte forme for		_		
•	roposals to drill or to deepen or reentry to a diff ION FOR PERMIT for such proposals	acat reservoir.		
			7. It Unit or CA, Agreement Designation	
	SUBMIT IN TRIPLICATE			
I. Type of Well X Oil Gas	INJECTION			
Well Other 2. Name of Operator			8 VINAME OF IEASE & WEII Warren Unit Blin/Tubb WF Well #54	
10 Desta Dr., Suite 100W,	30 025 26125 10. Field and Pool, or Exploratory Area			
Location of Well (Footage, Sec.,	Warren Blinebry Tubb Oil & Gas			
Surface: 1980' FNL & 660' FWL Sec 26, T20S, R38E, Unit Ltr E TD: same as above			11. County or Parish, State	
			Lea, NM	
2. CHECK APPROP	RIATE BOX(s) TO INDICATE NATURE OF	NOTICE, REPORT, O	R OTHER DATA	
TYPE OF SUBN	lission	TYPE OF ACTION		
Notice of Inten		andonment	Change of Plans	
L		completion	New Construction	
X Subsequent R	eport Pi	gging Back	Non-Routine Fracturing	
		sing Repair	Water Shut-Off	
Final Abandon		ering Casing	Conversion to Injection	
	X Tub	ng	Dispose Water	
directionally drilled, give sut 12-2-98: MIRU, ope free, tagge	d Operations (Clearly state all pertinent details, and give pertinent surface locations and measured and true vertical depths for all ma en up well, worked w/pump, back off rods, I ed @ 6690', TOOH w/181 jts tbg. SION.	dates, including estimated date o rkers and zones pertinent to this v 200H w/rods, ND wet	Phote: Respont results of multiple completion on Well Completion or Recompletion Report and Lag Rom.) If starting any proposed work. If well is work.)*	
directionally drilled, give sut 12-2-98: MIRU, opd free, tagge 12-3-98: Opened u POOH, rig 12-4-98: RiH w/ba 12-7-98: Open up 6329', pun 12-8-98: Open up 12-9-98: POOH, la 12-10-98: RIH w/ro 12-11-98: Check p	d Operations (Clearly state all pertinent details, and give pertinent surface locations and measured and true vertical depths for all ma en up well, worked w/pump, back off rods, I	dates, including estimated date o rkers and zones pertinent to this v POOH w/rods, ND wel jt w/pump stuck inside ull above perfs, SION. tag @ 67/6', pump 50 N. 67', SION. set TAC, NU wellhead sing, got well pumping , hot oiled rods & tubir	•Note: Report results of maliple completion on Well Completion or Recompletion Report and Log torm.) •Fatarting any proposed work. If well is work.)* Ihead, NU BOP, worked pump e, RIH w/tbg, RU scanalog, 0 gals 15% acid, pulled to , RIH w/pump & rods, SION. ;; ig, tested tbg, well on production. FED FOR RECOMPLASS GD.) DAVID R. GLASS	
directionally drilled, give sut 12-2-98: MIRU, opd free, tagge 12-3-98: Opened u POOH, rig 12-4-98: RiH w/ba 12-7-98: Open up 6329', pun 12-8-98: Open up 12-9-98: POOH, la 12-10-98: RIH w/ro 12-11-98: Check p	en up well, worked w/pump, back off rods, I surface locations and measured and true vertical depths for all ma en up well, worked w/pump, back off rods, I ed @ 6690', TOOH w/18I jts tbg. SION. up, finish POOH w/tbg to rods, pull rods, lay down scanalog, SION. iller & tbg, tag @ 6245', cleaned to 6352', pu well, POOH lay down bailer, RIH w/SN, tbg np 500 gallons acid, start POOH w/tbg, SIO , continue out of hole w/tbg, clean out to 67 id down bailer, RIH w/SN 2 3/8", ND BOP, ods, seat pump, load & test, hoto il down ca ump action, pump sticking-unseated pump	dates, including estimated date o rkers and zones pertinent to this v POOH w/rods, ND wel jt w/pump stuck inside ull above perfs, SION. tag @ 67/6', pump 50 N. 67', SION. set TAC, NU wellhead sing, got well pumping , hot oiled rods & tubir	•Note: Report results of multiple completion on Well Completion or Recompletion Report and Lag Rom.) It starting any proposed work. If well is work.)* Ihead, NU BOP, worked pump e, RIH w/tbg, RU scanalog, 0 gals 15% acid, pulled to , RIH w/pump & rods, SION. g, tested tbg, well on production. ED FOR RECORD AD.) DAVID H: GLASS	
directionally drilled, give sut 12-2-98: MIRU, opd free, tagge 12-3-98: Opened u POOH, rig 12-4-98: RiH w/ba 12-7-98: Open up 6329', pun 12-8-98: Open up 12-9-98: POOH, la 12-10-98: RIH w/ro 12-11-98: Check p	en up well, worked w/pump, back off rods, I surface locations and measured and true vertical depths for all ma en up well, worked w/pump, back off rods, I ed @ 6690', TOOH w/18I jts tbg. SION. up, finish POOH w/tbg to rods, pull rods, lay down scanalog, SION. iller & tbg, tag @ 6245', cleaned to 6352', pu well, POOH lay down bailer, RIH w/SN, tbg np 500 gallons acid, start POOH w/tbg, SIO , continue out of hole w/tbg, clean out to 67 id down bailer, RIH w/SN 2 3/8", ND BOP, ods, seat pump, load & test, hoto il down ca ump action, pump sticking-unseated pump	dates, including estimated date o rkers and zones pertinent to this v POOH w/rods, ND wel jt w/pump stuck inside ull above perfs, SION. tag @ 67/6', pump 50 N. 67', SION. set TAC, NU wellhead sing, got well pumping , hot oiled rods & tubir OFIG. SC	•Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) It starting any proposed work. If well is work.)* Ihead, NU BOP, worked pump e, RIH w/tbg, RU scanalog, 0 gais 15% acid, pulled to , RIH w/pump & rods, SION. g, tested tbg, well on production. ED FOR RECORD AD.) DAVID H: GLASS	
directionally drilled, give sut 12-2-98: MIRU, opd free, tagge 12-3-98: Opened u POOH, rig 12-4-98: RiH w/ba 12-7-98: Open up 6329', pun 12-8-98: Open up 12-9-98: POOH, la 12-10-98: RIH w/ro 12-11-98: Check p	en up well, worked w/pump, back off rods, l en up well, worked w/pump, back off rods, l ed @ 6690', TOOH w/l8l jts tbg. SION. up, finish POOH w/tbg to rods, pull rods, lay down scanalog, SION. iler & tbg, tag @ 6245', cleaned to 6352', pr well, POOH lay down bailer, RIH w/SN, tbg np 500 gallons acid, start POOH w/tbg, SIO , continue out of hole w/tbg, clean out to 67 id down bailer, RIH w/SN 2 3/8", ND BOP, ods, seat pump, load & test, hoto il down ca ump action, pump sticking-unseated pump 8' 2 3/8" tubing, ran 6684' 2 3/8" tubing.	dates, including estimated date o rkers and zones pertinent to this v POOH w/rods, ND wel jt w/pump stuck inside ull above perfs, SION. tag @ 67/6', pump 50 N. 67', SION. set TAC, NU wellhead sing, got well pumping , hot oiled rods & tubir OFIG. SC	Wote: Report results of maliple completion in Well Completion or Recompletion Report and Log form.) It starting any proposed work. If well is work.)* Ihead, NU BOP, worked pump e, RIH w/tbg, RU scanalog, 0 gais 15% acid, pulled to , RIH w/pump & rods, SION. g, tested tbg, well on production. FED FOR RECORDERS AD.) DAVID R. GLASS	
directionally drilled, give sut 12-2-98: MIRU, ope free, tagge 12-3-98: Opened u POOH, rig 12-4-98: RIH w/ba 12-7-98: Open up 6329', pun 12-8-98: POOH, la 12-10-98: RIH w/ro 12-11-98: Check p Pulled 664	d Operations (Clearly state all pertinent details, and give pertinent surface locations and measured and true vertical depths for all ma en up well, worked w/pump, back off rods, I ed @ 6690', TOOH w/18i jts tbg. SION. up, finish POOH w/tbg to rods, pull rods, lay down scanalog, SION. iler & tbg, tag @ 6245', cleaned to 6352', pu well, POOH lay down bailer, RIH w/SN, tbg np 500 gallons acid, start POOH w/tbg, SIO , continue out of hole w/tbg, clean out to 67 id down bailer, RIH w/SN 2 3/8", ND BOP, ods, seat pump, load & test, hoto il down ca ump action, pump sticking-unseated pump i8' 2 3/8" tubing, ran 6684' 2 3/8" tubing.	dates, including estimated date o rkers and zones pertinent to this v POOH w/rods, ND wel jt w/pump stuck inside all above perfs, SION. tag @ 67/6', pump 50 N. 67', SION. set TAC, NU wellhead sing, got well pumping hot oiled rods & tubir ACCEPT OFIG. SC	Prote: Report results of maliple completion on Well Completion or Recompletion Report and Log form.) Fatarting any proposed work. If well is work.)* Ihead, NU BOP, worked pump e, RIH w/tbg, RU scanalog, 0 gals 15% acid, pulled to , RIH w/pump & rods, SION. g, tested tbg, well on production. ED FOR REPORT Y 0 4 1999 BLM	
directionally drilled, give sut 12-2-98: MIRU, ope free, tagge 12-3-98: Opened u POOH, rig 12-4-98: RIH w/ba 12-7-98: Open up 6329', pun 12-8-98: POOH, la 12-10-98: RIH w/ro 12-11-98: Check p Pulled 664 I4: Thereby certify that the foregoing Signed	d Operations (Clearly state all pertinent details, and give pertinent surface locations and measured and true vertical depths for all ma en up well, worked w/pump, back off rods, I ed @ 6690', TOOH w/18i jts tbg. SION. up, finish POOH w/tbg to rods, pull rods, lay down scanalog, SION. iler & tbg, tag @ 6245', cleaned to 6352', pr well, POOH lay down bailer, RIH w/SN, tbg np 500 gallons acid, start POOH w/tbg, SIO , continue out of hole w/tbg, clean out to 67 id down bailer, RIH w/SN 2 3/8", ND BOP, ' ods, seat pump, load & test, hoto il down ca nump action, pump sticking-unseated pump 8' 2 3/8" tubing, ran 6684' 2 3/8" tubing.	dates, including estimated date o rkers and zones pertinent to this v POOH w/rods, ND wel jt w/pump stuck inside all above perfs, SION. tag @ 67/6', pump 50 N. 67', SION. set TAC, NU wellhead sing, got well pumping hot oiled rods & tubir ACCEPT OFIG. SC	Prote: Report results of maliple completion on Well Completion or Recompletion Report and Log form.) If starting any proposed work. If well is work.)* Ihead, NU BOP, worked pump e, RIH w/tbg, RU scanalog, 0 gais 15% acid, pulled to , RIH w/pump & rods, SION. g, tested tbg, well on production. ED FOR RECORDANS AY 0 4 1999 BLM Date 4-27-99	
directionally drilled, give sut 12-2-98: MIRU, ope free, tagge 12-3-98: Opened u POOH, rig 12-4-98: RIH w/ba 12-7-98: Open up 6329', pun 12-8-98: Open up 12-9-98: POOH, la 12-10-98: RIH w/ro 12-11-98: Check p Pulled 664	d Operations (Clearly state all pertinent defails, and give pertinent surface locations and measured and true vertical depths for all ma en up well, worked w/pump, back off rods, I ed @ 6690', TOOH w/l8l jts tbg. SION. up, finish POOH w/tbg to rods, pull rods, lay down scanalog, SION. iler & tbg, tag @ 6245', cleaned to 6352', pi well, POOH lay down bailer, RIH w/SN, tbg np 500 gallons acid, start POOH w/tbg, SIO , continue out of hole w/tbg, clean out to 67 id down bailer, RIH w/SN 2 3/8'', ND BOP, ods, seat pump, load & test, hoto il down ca sump action, pump sticking-unseated pump attion, pump sticking-unseated pump	dates, including estimated date o rkers and zones pertinent to this v POOH w/rods, ND wel jt w/pump stuck inside all above perfs, SION. tag @ 67/6', pump 50 N. 67', SION. set TAC, NU wellhead sing, got well pumping hot oiled rods & tubir ACCEPT OFIG. SC	Prote: Report results of maliple completion on Well Completion or Recompletion Report and Log form.) If starting any proposed work. If well is work.)* Ihead, NU BOP, worked pump e, RIH w/tbg, RU scanalog, 0 gais 15% acid, pulled to , RIH w/pump & rods, SION. g, tested tbg, well on production. ED FOR RECORDANS AY 0 4 1999 BLM Date 4-27-99	
directionally drilled, give sut 12-2-98: MIRU, ope free, tagge 12-3-98: Opened u POOH, rig 12-4-98: RIH w/ba 12-7-98: Open up 6329', pun 12-8-98: Open up 12-9-98: POOH, la 12-10-98: RIH w/rd 12-11-98: Check p Pulled 664 I4. Thereby certify that the foregoing Signed (This space for Federal or State Approved by	d Operations (Clearly state all pertinent details, and give pertinent surface locations and measured and true vertical depths for all ma en up well, worked w/pump, back off rods, I ed @ 6690', TOOH w/18i jts tbg. SION. up, finish POOH w/tbg to rods, pull rods, lay down scanalog, SION. iler & tbg, tag @ 6245', cleaned to 6352', pr well, POOH lay down bailer, RIH w/SN, tbg np 500 gallons acid, start POOH w/tbg, SIO , continue out of hole w/tbg, clean out to 67 id down bailer, RIH w/SN 2 3/8", ND BOP, ' ods, seat pump, load & test, hoto il down ca nump action, pump sticking-unseated pump 8' 2 3/8" tubing, ran 6684' 2 3/8" tubing.	dates, including estimated date o rkers and zones pertinent to this v POOH w/rods, ND wel jt w/pump stuck inside all above perfs, SION. tag @ 67/6', pump 50 N. 67', SION. set TAC, NU wellhead sing, got well pumping , hot oiled rods & tubir ACCEPT OPIG. SC M	Prote: Report results of maliple completion on Well Completion or Recompletion Report and Log form.) If starting any proposed work. If well is work.)* Ihead, NU BOP, worked pump e, RIH w/tbg, RU scanalog, 0 gais 15% acid, pulled to , RIH w/pump & rods, SION. g, tested tbg, well on production. ED FOR RECORDANS AY 0 4 1999 BLM Date 4-27-99	
directionally drilled, give sut 12-2-98: MIRU, ope free, tagge 12-3-98: Opened u POOH, rig 12-4-98: RIH w/ba 12-7-98: Open up 6329', pun 12-8-98: POOH, la 12-10-98: RIH w/ro 12-11-98: Check p Pulled 664 I4. Thereby certify that the foregoing Signed	d Operations (Clearly state all pertinent defails, and give pertinent surface locations and measured and true vertical depths for all ma en up well, worked w/pump, back off rods, I ed @ 6690', TOOH w/l8l jts tbg. SION. up, finish POOH w/tbg to rods, pull rods, lay down scanalog, SION. iler & tbg, tag @ 6245', cleaned to 6352', pi well, POOH lay down bailer, RIH w/SN, tbg np 500 gallons acid, start POOH w/tbg, SIO , continue out of hole w/tbg, clean out to 67 id down bailer, RIH w/SN 2 3/8'', ND BOP, ods, seat pump, load & test, hoto il down ca sump action, pump sticking-unseated pump attion, pump sticking-unseated pump	dates, including estimated date o rkers and zones pertinent to this v POOH w/rods, ND wel jt w/pump stuck inside all above perfs, SION. tag @ 67/6', pump 50 N. 67', SION. set TAC, NU wellhead sing, got well pumping , hot oiled rods & tubir ACCEPT OPIG. SC M	Prote: Report results of maliple completion on Well Completion or Recompletion Report and Log torm.) F starting any proposed work. If well is work.)* Ihead, NU BOP, worked pump e, RIH w/tbg, RU scanalog, 0 gals 15% acid, pulled to , RIH w/pump & rods, SION. j, ig, tested tbg, well on production. FED FOR RECOMPLASS AD.) DAVID R. SS AY 0 4 1999 Date 4-27-99	
directionally drilled, give sut 12-2-98: MIRU, ope free, tagge 12-3-98: Opened u POOH, rig 12-4-98: RIH w/ba 12-7-98: Open up 6329', pun 12-8-98: Open up 12-9-98: POOH, la 12-10-98: RIH w/rd 12-11-98: Check p Pulled 664 14. Thereby certify that the foregeting Signed (This space for Federal or State Approved by Conditions of approval, if any:	d Operations (Clearly state all pertinent details, and give pertinent surface locations and measured and true vertical depths for all ma en up well, worked w/pump, back off rods, I ed @ 6690', TOOH w/l8l jts tbg. SION. up, finish POOH w/tbg to rods, pull rods, lay down scanalog, SION. iler & tbg, tag @ 6245', cleaned to 6352', pi well, POOH lay down bailer, RIH w/SN, tbg np 500 gallons acid, start POOH w/tbg, SIO , continue out of hole w/tbg, clean out to 67 id down bailer, RIH w/SN 2 3/8", ND BOP, ods, seat pump, load & test, hoto il down ca ump action, pump sticking-unseated pump as' 2 3/8" tubing, ran 6684' 2 3/8" tubing.	dates, including estimated date o rkers and zones pertinent to this v POOH w/rods, ND wel jt w/pump stuck inside ull above perfs, SION. tag @ 67/6', pump 50 N. 67', SION. set TAC, NU wellhead sing, got well pumping , hot oiled rods & tubir ACCEPT ORIG. SC M	Point: Report results of maliple completion in Well Completion or Recompletion Report and Log form.) It starting any proposed work. If well is work.)* Ihead, NU BOP, worked pump e, RIH w/tbg, RU scanalog, 0 gals 15% acid, pulled to , RIH w/pump & rods, SION. g, tested tbg, well on production. ED FOR RECOMPLASS AY 0 4 1999 Date	
directionally drilled, give sut 12-2-98: MIRU, ope free, tagge 12-3-98: Opened u POOH, rig 12-4-98: RIH w/ba 12-7-98: Open up 6329', pun 12-8-98: Open up 12-9-98: POOH, la 12-10-98: RIH w/rd 12-11-98: Check p Pulled 664 14. Thereby certify that the foregeting Signed (This space for Federal or State Approved by Conditions of approval, if any:	d Operations (Clearly state all pertinent defails, and give pertinent surface locations and measured and true vertical depths for all ma en up well, worked w/pump, back off rods, I ed @ 6690', TOOH w/l8l jts tbg. SION. up, finish POOH w/tbg to rods, pull rods, lay down scanalog, SION. iler & tbg, tag @ 6245', cleaned to 6352', pi well, POOH lay down bailer, RIH w/SN, tbg np 500 gallons acid, start POOH w/tbg, SIO , continue out of hole w/tbg, clean out to 67 id down bailer, RIH w/SN 2 3/8", ND BOP, i ods, seat pump, load & test, hoto il down ca ump action, pump sticking-unseated pump as' 2 3/8" tubing, ran 6684' 2 3/8" tubing.	dates, including estimated date o rkers and zones pertinent to this v POOH w/rods, ND wel jt w/pump stuck inside ull above perfs, SION. tag @ 67/6', pump 50 N. 67', SION. set TAC, NU wellhead sing, got well pumping , hot oiled rods & tubir ACCEPT ORIG. SC M	Pete: Report results of maliple completion in Well Completion or Recompletion Report and Log form.) It starting any proposed work. If well is work.)* Ihead, NU BOP, worked pump e, RIH w/tbg, RU scanalog, 0 gals 15% acid, pulled to , RIH w/pump & rods, SION. g, tested tbg, well on production. ED FOR RECOMPLASS AY 0 4 1999 Date	

(7	۱ ن		
	1	J	Q	
		v		