

6. Release RBP at 5150'. POOH w/RBP, RTTS pkr, and 2 7/8" tubing. RIH w/RTTS pkr and 2 7/8" tubing. Flow or swab back load.
7. POOH w/RTTS pkr and 2 7/8" tubing. Run tracer survey over Blinebry section treated.
8. RIH w/2 7/8" tubing. POOH w/2 7/8" tubing and RBP.
9. RIH w/2 7/8" tubing and 7" production pkr. Set pkr at \pm 6500'. RIH w/2 1/16" tubing with dual anchor catcher. Set anchor catcher at \pm 5500'.
10. RIH w/rods and pump. Place both zones on production.

