

Bumped plug with 2200 psi. Released pressure, held okay. Circulated 10 sacks to pit.

7. Installed slips. Cut off 7" casing. Waited on cement.
8. Drilled out stage tool and cleaned out casing to 6744'. Tested casing to 2000 psi. Held okay.
9. Ran Gamma Ray - cement bond - collar log. Cement bond indicated top of first stage @ 4100'. Second stage circulated.