

8. (1-13-94) Bled off press after 24 hrs & 9 5/8" & 7" csg were both static.
9. (1-24-94) Tag cement 3017' Run freepoint on 7" csg, cut & pull 2950'.
10. (1-25-94) Displace hole 3000' to surface w/ 10# brine gel, pump 35 SX cement 3000'-2875', 35 SX cement 2500'-2400', 35 SX cement 1250'-1150', & 100 SX 300'-surface. Install P & A marker, clean location & RDPU.