

## RECOMPLETION PROCEDURE

William Turner No. 4

Purpose: Recomplete to the Blinebry Formation and Downhole Commingle with the Abo Formation.

1. MIRUPU. POOH rod string and pump.
2. ND wellhead. NU BOP equipment. POOH with tubing and TAC.
3. Pressure test pipe rams and blind rams to 1000 psi.
4. TIH and set RBP at 5780'. POOH.
5. Selectively perforate lower Blinebry formation from 5726'-5762'.
6. Acidize and sand frac lower Blinebry. Test lower Blinebry.
7. TIH and set RBP at 5675'.
8. Selectively upper perforate Blinebry from 5536'-5603'.
9. Acidize and sand frac upper Blinebry. Test upper Blinebry.
10. Clean out sand to RBP at 5675'. POOH with RBP from 5675'.
11. Clean out sand to RBP at 5780'. Test Blinebry and file DHC application.
12. POOH with RBP from 5780'.
13. Complete the well with 2-3/8" tubing, rods and pump.
14. RDMOPU.

5  
C  
3

4  
10/10/00  
Received  
10/10/00