

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
LG-893	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name
2. Name of Operator HNG OIL COMPANY		8. Farm or Lease Name San Simon 6 State
3. Address of Operator P. O. Box 2267, Midland, Texas 79702		9. Well No. 2
4. Location of Well UNIT LETTER <u>J</u> <u>1980</u> FEET FROM THE <u>south</u> LINE AND <u>1980</u> FEET FROM THE <u>east</u> LINE, SECTION <u>6</u> TOWNSHIP <u>22S</u> RANGE <u>35E</u> NMPM.		10. Field and Pool, or Wildcat San Simon Wolfcamp
15. Elevation (Show whether DF, RT, GR, etc.) 3610.1' GR		12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF: 9/22/82
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>
	ALTERING CASING <input type="checkbox"/>
	PLUG AND ABANDONMENT <input type="checkbox"/>
	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-25-82 MIRU

10-27-82 - Set CIBP at 11,100' + 35' cement on top.

10-28-82 - Cut and recovered 5675' 5" 15# casing.

10-29-82 - Mix and spot 15 sx. Cl H cement from 6997' - 6897'.
 Mix and spot 25 sx. Cl H from 5722 - 5593'. Tagged cement plug at 5593'.
 Mix and spot 50 sx. Cl H from 4136 - 4036'.
 Mix and spot 50 sx. Cl H from 2208 - 2108'.
 Mix and circ. 15 sx. Cl H from 30' to surface.

10-30-82 - Cut off bradenhead and anchors; weld on dry-hole marker; cleaned up location.

(OVER)

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Betty Gildon TITLE Regulatory Analyst DATE 11/2/82APPROVED BY David R. Catano TITLE OIL & GAS INSPECTOR DATE 3-23-83

CONDITIONS OF APPROVAL, IF ANY:

Casing Record After Plugging

13-3/8" set at 1 00'. Left in well 1100'.
9-5/8" set at 5 00'. Left in well 5700'.
5" set at 10 50'. Left in well 5840'.
2-3/8" tubing set at 11015' - left in well 0'.

2087 1 04

03 1 50