

Submit 3 Copies To Appropriate District
Office
District I
1625 N French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.

30-025-27627

5. Indicate Type of Lease

STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

HUEY

8. Well No.

1

9. Pool name or Wildcat

Nadine; Paddock-Blinebry, West

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Chesapeake Operating, Inc.

3. Address of Operator

P.O. Box 18496, Okla. City, OK 73154-0496

4. Well Location

Unit Letter K : 2080 feet from the South line and 1980 feet from the West line

Section 5

Township 20S Range 38E NMPM Lea County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)

GR: 3580'

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: Add Perfs & Treat ☒

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Prepare to perforate & stimulate Blinebry

10/14/02 MIRU reverse Unit, PU 3-1/2" DCs, 3/4" bit & 2-7/8" tbg, tag @6158', PU swivel, break circ, drill scale & cmt down to 6200', drill out CIBP, push down to 6480', POOH w/tbg, LD DCs, SIW, SDFN

10/15/02 RU Schlumberger, RIH w/CIBP, correlate, set plug @5450, POOH w/bailer, dump 1 sk cmt on top of plug, POOH, PU gun, RIH, perf Blinebry 6305-16 (10 holes), w/csg gun w/2 spf, .42" hole, 60° phasing. Reperf 1st Blinebry 5937-49' (14 holes), Perf Upr Blinebry 5867-73' (8 holes). RD Schlumberger, PU 5-1/2" pkr & plug, RIH to 6800', leave swinging, SIW, SDFN

10/16/02 Isolate 6305-16, spot scid, set pkr @6275' & acidize w/3000 gal 15% NEFe acid. Isolate existing 6018-58 w/tools & Acidize w/2000 gal same acid. space 25 ball sealers & maintain min. rates of 6 BPM; Isolate Upr Blinebry 5937-49 w/tools. Again 2000 gal same acid w/20 ball sealers thru job w/min rates of 6 BPM. Isolate 5867-73' & acidize w/2000 gal same acid w/20 ball sealers thru job w/6BPM. Lwr pkr to clear perfs of ball sealers. Isolate & swab 5867-73, POOH w/tools, RIH w/prod tbg to +6325, swab to clean up hole.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Andrew J. McCalmont TITLE Asset Manager DATE 10/25/02

Type or print name Andrew J. McCalmont

Telephone No. (405) 848-8000

(This space for State use)

APPROVED BY

Conditions of approval, if any:

ORIGINAL SIGNED BY

DATE

OC FIELD REPRESENTATIVE II/STAFF MANAGER

DATE

NOV - 1 2002