

7. RIH W/WS & PKR. HOWCO SPOT 2 BBLS 15% NEFE FROM 6372-6288. PU & SET PKR AT 6250. TRAP 500 PSI ON CSG. HOWCO ACDZ PERFS 6307-72 W/6000 GALS 15% NEFE AT 5 BPM DROPPING 90 BALL SEALERS SPACED EVENLY THRUOUT. MAX TP 5000 PSI.
8. SWAB L&AW. DETERMINE FE & CONTENT. IF FURTHER STIMULATION NEEDED, HOWCO FRAC PERFS 6307-72 W/22,000 GALS PUR-GEL-30** CARRYING 29,500# SD. PUMP AT 20 BPM. - EXPECTED WHTP 4500 PSI. MAX ALLOW TP 6000 PSI. TRAP 1000 PSI ON CSG. |