

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-29320
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name C.H. WEIR "A"
8. Well No. 17
9. Pool name or Wildcat SKAGGS DRINKARD
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3571' DF

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER
2. Name of Operator Texaco Exploration and Production Inc.
3. Address of Operator P. O. Box 730 Hobbs, NM 88240
4. Well Location Unit Letter <u>K</u> : <u>1720</u> Feet From The <u>SOUTH</u> Line and <u>2103</u> Feet From The <u>WEST</u> Line Section <u>12</u> Township <u>20-S</u> Range <u>37-E</u> NMPM LEA
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3571' DF

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☒ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12/2/92 - 12/12/92

- MIRU. TESTED 5 1/2" CSG TO 500# FOR 30 MIN, OK. TOH W/ PKR. C/O TO 7017'.
- PERFD THE FOLLOWING INTERVAL W/ 2 JSPI: 6643, 52, 53, 59, 61, 67, 74, 87-89, 90, 91, 96-6708, 13, 21, 24, 33-35, 53, 60, 67-70, 72, 73, 75, 87, 88, 92, 6806, 17, 18, 19, 32, 36, 49, 51, 53, 60, 62, 63, 55, 71, 73, 89, (60 INT; 120 HLES)
- ACIDIZED DRINKARD PERFS FR 6609'-6891' W/ 3500 GALS 15% NEFE. AVG P = 100#, AIR = 6 BPM.
- FRACD DRINKARD PERFS FR 6609'-6891' W/ 67,000 GALS 30# XL GEL, 228,000# 20/40 OTTAWA & 60,000# 12/20 SAND. AVG P = 5100#, AIR = 31 BPM.
- C/O TO 7019', RETURNED WELL TO PRODUCTION.
OPT 12/17/92 159 BOPD, 20 BWPD, 926 MCFD

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Monte C. Duncan TITLE ENGINEER'S ASSISTANT DATE 1/13/93
TYPE OR PRINT NAME MONTE C. DUNCAN TELEPHONE NO. 393-7191

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

JAN 15 1993

RECEIVED

JAN 14 1993

OCD HOBBS OFFICE