

Langley Boren #2
Recommended Stimulation

1. Cut paraffin. (Production Department.)
2. Kill well by reverse circulating hole with 2% KCl water or 9 ppg BW.
3. POOH w/tubing and packer.
4. PU BJ-Titan's PFT tool and GIH.
5. Move down through perfs in circulating mode, pumping 1500 gals 2% KCl.
6. Move up through perfs in injecting mode, pumping 1500 gals 15% HCl and 500 gals Xylene (2000 gals 75/25 mix) at 1-2 bpm at 1500 psi.
7. Flush past the bottom perf w/2% KCl water.
8. POH w/PFT.
9. Re-run CA for flowing well.
10. Swab well in.