State of New Mexico

Form C-103

Submit 3 copies to Appropriate District Office Ener Minerals and Natural Resources Department Revised 1-1-89 DISTRICT I OIL CONSERVATION DIVISION WELL API NO. P.O. Box 1980, Hobbs, NM 88240 P.O. Box 2088 30 025 30806 DISTRICT II Santa Fe, New Mexico 87504-2088 Indicate Type of Lease P.O. Box Drawer DD, Artesia, NM 88210 STATE [FEE 🗸 **DISTRICT III** 6. State Oil / Gas Lease No. 1000 Rio Brazos Rd., Aztec, NM 87410 SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMI KERSHAW, L. R. (FORM C-101) FOR SUCH PROPOSALS. OIL 1. Type of Well: GAS \checkmark WELL WELL **OTHER** 2. Name of Operator 8. Well No. 15 TEXACO EXPLORATION & PRODUCTION INC. 3. Address of Operator 9. Pool Name or Wildcat 205 E. Bender, HOBBS, NM 88240 WEIR BLINEBRY EAST/MONUMENT TUBB 4. Well Location Feet From The EAST Unit Letter____B_ : 330 Feet From The NORTH Line and 2305 __ Township 20-S Range 37-E _ NMPM LEA COUNTY 10. Elevation (Show whether DF, RKB, RT,GR, etc.) GL-3556', KB-3569' 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING **TEMPORARILY ABANDON** CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT **PULL OR ALTER CASING** CASING TEST AND CEMENT JOB OTHER: **FSH STUCK TBG & RODS-POP** OTHER: **V** 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 5-15-00: MIRU. 5-16-00: CUT PARAFFIN TO 3000'. TIH W/BOX TAP ON RDS. SCREW IN @ 5325'. REL BOX TAP. 5-17-00: NDWH. NUBOP. PUMP 120 BBLS 2% KCL DN BACKSIDE. 5-18-00: TIH W/BIT, DC'S ON WS. STOP BIT @ 4509'. RU FOAM UNIT. INSTL SPOOL & STRIPPER HEAD. 5-19-00: C/O SAND, SCALE, IRON SULFIDE 6458-6582'. PULL BIT TO 5595'. 5-22-00: LOWER TBG & TOOLS. TAG @ 6582'. NO FILL. RD FOAM UNIT. TIH W/PKR, SN ON WS. SET PKR @ 5694'. LOAD & TEST BACKSIDE TO 500#-OK. RD REV UNIT. 5-23-00: PRESS CSG TO 500#-OK. ACIDIZE TUBB/BLINEBRY PERFS 5754-6567' W/2500 GALS 15% NEFE HCL. RU SWAB. FL @ 2400'. END FL @ 4200'. 5-24-00: FL @ 3800'. END FL @ 4400'. RD SWAB. REL PKR. TAG SALT FILL @ 6430'. TIH W/PROD TBG TO 1900'. 5-25-00: TIH W/TBG & TAG @ 6460'. WASH SALT FILL FR 6460-6582'. TIH W/OPSMA, SN, TBG, TAC. 5-26-00: TIH W/TBG. MA @ 6556', SN @ 6524', TAC @ 5686'. NDBOP. NUWH. TIH W/RDS. TIH W/GAS ANCHOR, PUMP, RDS. 5-30-00: HUNG ON. LOAD & TEST W/20 BFW. OK. RIG DOWN. 6-20-00: ON 24 HR OPT. PUMP 20 BO, 69 BW, & 58 MCF. **FINAL REPORT** I hereby certify that the Engineering Assistant SIGNATUR DATE 6/26/00 TYPE OR PRINT NAME J. Denise Leake Telephone No. 397-0405 SHE WAS LAMS

(This space for State Use)

APPROVED

BUNDITIONS OF APPROVAL, IF ANY:

ORIGINAL SIGNE _TITLE_DISCHOO

DATE

