		LOIL CONS. COMMISSION	
orm 3160-5 une 1990)	UNIT DEPARTMEN	TOF THE INTERIOR	FORM APPROVED Budget Bureau No. 1004-0135 Expires: March 31, 1993 5. Lease Designation and Serial No.
		the second se	NM-27805
Do not use this f	orm for proposals to dri	AND REPORTS ON WELLS 10 40 III or to deepen or reentry to a different r R PERMIT—" for such proposals	6. If Indian, Allottee or Tribe Name reservoir.
		IN TRIPLICATE	7. If Unit or CA, Agreement Designation
I. Type of Well X Oil Gas Well Well			8. Well Name and No.
A well Well Other			Lechuza Federal #1
Strata Production Company			9. API Well No. 30-025-31495
3. Address and Telephone No. P.O. Box 1030, Roswell, New Mexico 88202-1030 (505) 622-1127			
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)			11. County or Parish, State
	862' FSL & 458' F Section 15-22S-32		Lea County, NM
12. CHECK	APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTIC	E, REPORT, OR OTHER DATA
	TYPE OF SUBMISSION TYPE OF ACTION		
·····	of Intent	Abendoament	Change of Plans
L Notice	OI INCIA	Recompletion	New Construction
Subsequent Report		Plugging Back	Non-Routine Fracturing
Final Abandonment Notice		Casing Repair	Water Shut-Off
		Altering Casing Other	(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)
<u>06/25/93</u> : <u>06/26/93</u> : <u>06/30/93</u> : <u>07/01/93</u> :	RU pulling un 5 1/2" 17# RB Perforate "B" w/1250 gal 7 Frac via 2 7 16/30 RC. Sw Perforate "A"	P. Set RBP at 7190'. zone from 7092'-7110'. S 1/2% NEFE. Swab test. /8" tubing with 9750 gal ab test. zone with 14 holes (2 sp cone from 7039'-7045' with	th pump and rods. TIH with Set packer at 7011'. Acidize . 35# X-Link gel and 11250#
	BS. Swab tes gel and 16000	st. Frac via 2 778" tubi 0# 16/30 DC.	Set TA. Flange up tubing.
07/03/93	BS. Swab tes gel and 16000 TIH with prod	st. Frac via 2 778" tubi 0# 16/30 DC. duction string. ND BOP. head. TIH with rods and pumping unit. Well place	Set TA. Flange up tubing. pump. Space out and hang on ed on production.
07/03/93	BS. Swab tes gel and 16000 TIH with prod	at. Frac via 2 778" tubi 0# 16/30 DC. Nuction string. ND BOP.	Set TA. Flange up tubing. pump. Space out and hang on ed on production.
07/03/93 : 14. I hereby carrify that t	BS. Swab tes gel and 16000 TIH with prod Hook up well he forgong is gue and tooket L.J. Darcin	st. Frac via 2 778" tubi 0# 16/30 DC. duction string. ND BOP. head. TIH with rods and pumping unit. Well place	Set TA. Flange up tubing. pump. Space out and hang on ed on production.