ubmit 3 Copies to Appropriate		
District Office	Energy, Minerals and Natural Resources Department	Form C 103 Revised 1-1-89
	OIL CONSERVATION DIVISION	
DISTRICT I P.O. Box 1980, Hobbs, NM S8240		WELL ATTNO.
DISTRICT II	P.O. Box 2088 Santa Fe, New Mexico 87504-2088	30 025 33028
P.O. Drawer DD, Artesia, NM 88210	Santa re, New Mexico 8/304-2088	5. Indicate Type of Lease STATE FEE
DISTRICT III		
1000 Rio Brazos Rd., Aztec, NM 87410		6. State Oila Gas Lease No. B 2656
	TICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
	ROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	
	ERVOIR. USE "APPLICATION FOR PERMIT" C-101) FOR SUCH PROPOSALS.)	
1. Type of Well:		
Oil Well Well	OTHER Injection	Hardy 36 State
2. Name of Operator		8. Well No.
Conoco Inc		21
3. Address of Operator		9. Pool name or Wildcat
10 Desta Dr. Ste 100W, Mid	and, Tx., 79705-4500	North Hardy Strawn
4. Well Location		
Unit Letter <u>L</u> <u>19</u>	80 Feet From The South Line and	330 Feet From The West
Section 36	Township 20S Range 37E	NMPM Lea Coun
///////////////////////////////////////	10. Elevation (Show whether DF, RKB. RT, GR, etc.) 3491	///////////////////////////////////////
· · · · · · · · · · · · · · · · · · ·		
	Appropriate Box to Indicate Nature of Notice,	• •
NOTICE OF I	NTENTION TO: SU	JBSEQUENT REPORT OF:
	PLUG AND ABANDON REMEDIAL WORK	
EMPORARILY ABANDON	CHANGE PLANS COMMENCE DRILL	ING OPNS PLUG AND ABANDONMENT
 		L J
PULL OR ALTER CASING	CASING TEST AND	L]
PULL OR ALTER CASING DTHER: 12. Describe Proposed or Completed work)SEE RULE 1103.	COMMENCE DRILL CASING TEST AND OTHERAdd perfs Operations (Clearly state all pertinent details, and give pertinent dates,	CEMENT JOB
 12. Describe Proposed or Completed work/SEE RULE 1103. 1-24-00: Moved in and rigged up. 1-25-00: Pull out of hole with tub: 1-26-00: Tested casing, checked p 1-27-00: RIH w/new RBP & packet ested casing from 7756' to 9980'. 1-28-00: RIH w/ 2 7/8" tubing, pa 1-2-00: RIH to pull RBP - release 1-3-00: Pulled out of hole w/RBP 1-5-00: RIH w/production string, 	COMMENCE DRILL CASING TEST AND OTHERAdd perfs Operations (Clearly state all pertinent details, and give pertinent dates, Pooh w/rods & pump. Installed BOP. Tested Pipe & Bl ing. RIH w/5 1/2" RBP - set @ 9988', pulled up & set pa vacker - had to pull packer and prep to run new packer. S er, set RBP @ 9980', pulled up one joint & set packer. T Released packer & POOH - rigged up wireline. Perfor cker set @ 7757', rigged up swab. SION. d RBP, began POOH. SION. , RIH & set RBP @ 9970', set packer @ 7755', RIH w/sr prep to run pump and put on production.	CEMENT JOB including estimated date of starting any proposed ind Rams to 1500#- SION. cker @ 7756'. SION. Fosted RBP, pulled up & set packer @ 7756', ated w/4 JSPF @ 7824-7864'. POOH. SION.
PULL OR ALTER CASING DTHER: 12. Describe Proposed or Completed work/SEE RULE 1103. -24-00: Moved in and rigged up. -25-00: Pull out of hole with tub. -26-00: Tested casing, checked p -27-00: RIH w/new RBP & pack ested casing from 7756' to 9980'. -28-00: RIH w/ 2 7/8" tubing, pa 5-2-00: RIH to pull RBP - release 5-3-00: Pulled out of hole w/RBP 5-5-00: RIH w/production string,	COMMENCE DRILL CASING TEST AND OTHERAdd perfs Operations (Clearly state all pertinent details, and give pertinent dates, Pooh w/rods & pump. Installed BOP. Tested Pipe & BI ing. RIH w/5 1/2" RBP - set @ 9988', pulled up & set pa wacker - had to pull packer and prep to run new packer. S er, set RBP @ 9980', pulled up one joint & set packer. T Released packer & POOH - rigged up wireline. Perfor cker set @ 7757', rigged up swab. SION. d RBP, began POOH. SION. , RIH & set RBP @ 9970', set packer @ 7755', RIH w/sv prep to run pump and put on production.	CEMENT JOB including estimated date of starting eny proposed ind Rams to 1500#- SION. cker @ 7756'. SION. HON. Fested RBP, pulled up & set packer @ 7756', ated w/4 JSPF @ 7824-7864'. POOH. SION. wab. SION.
PULL OR ALTER CASING DTHER: 12. Describe Proposed or Completed work/SEE RULE 1103. -24-00: Moved in and rigged up. -25-00: Pull out of hole with tub. -26-00: Tested casing, checked p -27-00: RIH w/new RBP & pack ested casing from 7756' to 9980'. -28-00: RIH w/ 2 7/8" tubing, pa 5-2-00: RIH to pull RBP - release 5-3-00: Pulled out of hole w/RBP 5-5-00: RIH w/production string,	COMMENCE DRILL CASING TEST AND OTHERAdd perfs Operations (Clearly state all pertinent details, and give pertinent dates, Pooh w/rods & pump. Installed BOP. Tested Pipe & Bl ing. RIH w/5 1/2" RBP - set @ 9988', pulled up & set pa vacker - had to pull packer and prep to run new packer. S er, set RBP @ 9980', pulled up one joint & set packer. T Released packer & POOH - rigged up wireline. Perfor cker set @ 7757', rigged up swab. SION. d RBP, began POOH. SION. , RIH & set RBP @ 9970', set packer @ 7755', RIH w/sr prep to run pump and put on production.	CEMENT JOB including estimated date of starting eny proposed ind Rams to 1500#- SION. cker @ 7756'. SION. HON. Fested RBP, pulled up & set packer @ 7756', ated w/4 JSPF @ 7824-7864'. POOH. SION. wab. SION.
PULL OR ALTER CASING DTHER: 12. Describe Proposed or Completed work/SEE RULE 1103. -24-00: Moved in and rigged up. -25-00: Pull out of hole with tub: -26-00: Tested casing, checked p -27-00: RIH w/new RBP & pack ested casing from 7756' to 9980'. -28-00: RIH w/new RBP & release -3-00: RIH w/ 2 7/8" tubing, pa -2-00: RIH to pull RBP - release -3-00: Pulled out of hole w/RBP -5-00: RIH w/production string, I hereby certify that the information provide	COMMENCE DRILL CASING TEST AND OTHERAdd perfs Operations (Clearly state all pertinent details, and give pertinent dates, Pooh w/rods & pump. Installed BOP. Tested Pipe & BI ing. RIH w/5 1/2" RBP - set @ 9988', pulled up & set pa wacker - had to pull packer and prep to run new packer. S er, set RBP @ 9980', pulled up one joint & set packer. T Released packer & POOH - rigged up wireline. Perfor cker set @ 7757', rigged up swab. SION. d RBP, began POOH. SION. , RIH & set RBP @ 9970', set packer @ 7755', RIH w/sv prep to run pump and put on production.	CEMENT JOB
PULL OR ALTER CASING DTHER: 12. Describe Proposed or Completed work/SEE RULE 1103. -24-00: Moved in and rigged up. -25-00: Pull out of hole with tub. -26-00: Tested casing, checked p -27-00: RIH w/new RBP & pack ested casing from 7756' to 9980'. -28-00: RIH w/new RBP & pack ested casing from 7756' to 9980'. -28-00: RIH w/2 7/8" tubing, pa -2-00: RIH to pull RBP - release -3-00: Pulled out of hole w/RBP -5-00: RIH w/production string, I hereby certify that the information results SIGNATURE	COMMENCE DRILL CASING TEST AND OTHERAdd perfs Operations (Clearly state all pertinent details, and give pertinent dates, Pooh w/rods & pump. Installed BOP. Tested Pipe & BI ing. RIH w/5 1/2" RBP - set @ 9988', pulled up & set pa wacker - had to pull packer and prep to run new packer. S er, set RBP @ 9980', pulled up one joint & set packer. T Released packer & POOH - rigged up wireline. Perfor cker set @ 7757', rigged up swab. SION. d RBP, began POOH. SION. , RIH & set RBP @ 9970', set packer @ 7755', RIH w/sv prep to run pump and put on production.	CEMENT JOB
PULL OR ALTER CASING DTHER: 12. Describe Proposed or Completed work/SEE RULE 1103. -24-00: Moved in and rigged up. -25-00: Pull out of hole with tub. -26-00: Tested casing, checked p -27-00: RIH w/new RBP & pack ested casing from 7756' to 9980'. -28-00: RIH w/ 2 7/8" tubing, pa -2-00: RIH w/ 2 7/8" tubing, pa -2-00: RIH w/production string, '-5-00: RIH w/production string, '-5-00: RIH w/production string, '-5-00: RIH w/production string, '-1 hereby certify that the information provide SIGNATURE ''YPE OR PRINT NAME ATIT E. Ritchie (this space for State Use)	COMMENCE DRILL CASING TEST AND OTHERAdd perfs Operations (Clearly state all pertinent details, and give pertinent dates, Pooh w/rods & pump. Installed BOP. Tested Pipe & Bl ing. RIH w/5 1/2" RBP - set @ 9988', pulled up & set pa wacker - had to pull packer and prep to run new packer. S er, set RBP @ 9980', pulled up one joint & set packer. T Released packer & POOH - rigged up wireline. Perfor cker set @ 7757', rigged up swab. SION. d RBP, began POOH. SION. , RIH & set RBP @ 9970', set packer @ 7755', RIH w/s prep to run pump and put on production.	CEMENT JOB
PULL OR ALTER CASING DTHER: 12. Describe Proposed or Completed work/SEE RULE 1103. -24-00: Moved in and rigged up. -25-00: Pull out of hole with tub: -26-00: Tested casing, checked p -27-00: RIH w/new RBP & pack ested casing from 7756' to 9980'. -28-00: RIH w/2 7/8" tubing, pair 2-00: RIH to pull RBP - release -3-00: Pulled out of hole w/RBP -5-00: RIH w/production string, I hereby certify that the information should be with the	COMMENCE DRILL CASING TEST AND OTHERAdd perfs Operations (Clearly state all pertinent details, and give pertinent dates, Pooh w/rods & pump. Installed BOP. Tested Pipe & BI ing. RIH w/5 1/2" RBP - set @ 9988', pulled up & set pa wacker - had to pull packer and prep to run new packer. S er, set RBP @ 9980', pulled up one joint & set packer. T Released packer & POOH - rigged up wireline. Perfor cker set @ 7757', rigged up swab. SION. d RBP, began POOH. SION. , RIH & set RBP @ 9970', set packer @ 7755', RIH w/s prep to run pump and put on production.	CEMENT JOB including estimated date of starting eny proposed ind Rams to 1500#- SION. cker @ 7756'. SION. HON. Fested RBP, pulled up & set packer @ 7756', ated w/4 JSPF @ 7824-7864'. POOH. SION. wab. SION.