CONDITIONS OF APPROVAL, IF ANY FILE

## State of New Mexico

Form C-103

Er v, Minerals and Natural Resources Department

District Office	.,	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	Revised 1-1-89
<u>DISTRICT I</u>	OIL CONSER	<b>RVATION DIVISION</b>	WELL API NO.
P.O: Box 1980, Hobbs, NM 88240	0		30 025 33782
DISTRICT II		D. Box 2088	
P.O. Box Drawer DD, Artesia, NM	88210 Santa Fe, Ne	ew Mexico 87504-2088	5. Indicate Type of Lease
DISTRICT III			STATE FEE S
1000 Rio Brazos Rd., Aztec, NM 8	87410		6. State Oil / Gas Lease No.
**************************************	NOTICES AND REPORTS	S ON WELL	
		TO DEEPEN OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name
	ESERVOIR. USE "APPLICAT		V. M. HENDERSON
	RM C-101) FOR SUCH PROP	OSALS.)	- V. M. HENDERSON
	WELL OTHER		
2. Name of Operator	OFFICE		8. Well No.
TEXACO EXPLORATION & PRODUCTION INC.			16
3. Address of Operator 205 E. Bender, HOBBS, NM 88240			9. Pool Name or Wildcat
		6.44- <b>3</b> February	Blinebry Oil & Gas
4. Well Location	4050	NORTH Line and CCO	Food From The MISOT
Unit Letter <u>E</u>	1650 Feet From 1	The NORTH Line and 660	Feet From The WEST Line
Section 30	Township 21-S	Range <u>37-E</u> N	NMPMLEA_ COUNTY
	10. Elevation (Snow Wr	nether DF, RKB, RT,GR, etc.) 3499'	
11. Chec	k Appropriate Box to Inc	dicate Nature of Notice, Repo	ort, or Other Data
	• • •		
NOTICE OF INTEN		_	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING O	PERATION PLUG AND ABANDONMENT
PULL OR ALTER CASING		CASING TEST AND CEM	IENT JOB
OTHER:		OTHER:	Completion
4-9-97: TIH w/ packer and set @ 54: 1325#, SDFN. 4-10-97: TOH with tbg and packer. 4-11-97: Frac Blinebry perfs w/36K. Flowback. SI 4-12-97: Release packer & TOH w/p 4-15-97: Clean out to PBTD 6600.	32'. Acidizé perfs 5487'-5604's TIH w/ frac packer, test to 8000 gals 35# gel w.100.6K 16/30 si backer & tubing. Tag sand. SI. Circ. SDFN.  (20) 5739'. ND BOP. Run pum er, SI. 5-17-97 thru 5-20-97: Sis. Install BOP & TOH w/tbg.  (20) 5746'. ND BOP. Run pum b. NU BOP. SI. 99'. Establish pump in rate 1-1 150#, SD for 48 hrs & wait on puter, blow of gas. 7-29-97 thru is CIBP 20 6600' Ran CIBP and s	D psi, set packer @ 5367'. SDFN. and w/39.6K 16/30 resin. Max Press. Wait on Air Foam Unit.  Inp and rods. RDMO. Pumping. St.  Inp and rods. RDMO. Well shut-in thruly BPM @ 100#. Pump 60 bbls Maraolymer.  19-23-97: Shut-in.  Inset @ 5400' and spot 35' cement on it.	3140#, Min Press 1534# , Ave Press 2100#. ISIP 5700#, Min Press 3918#, Avg 4800#, ISIP 1950#.
SIGNATURE AULE TYPE OR PRINT NAME	Paula S. Ives		DATE <u>10/3/97</u> Telephone No. 397-0432 <b>DCT 14</b> 1997
APPROVED BY	- SIGNED BY	_	DATE OUT 14 1937

DeSoto/Nichols 12-93 ver 1.0