orm 3160-5	UNITED STATE		
ine 1990)	DEPARTMENT OF THE I	10 4 00 0	FORM APPROVED Budget Bureau No. 1004-0135
		AGEMENTHODDS, NM 88241	Expires: March 31, 1993
			5. Lease Designation and Serial No.
	SUNDRY NOTICES AND DED		LC 03/620A
An and when the former f	SUNDRY NOTICES AND REPO		6. If Indian, Allottee or Tribe Name
Use "APPLICATION	osals to drill or to deepen or reentry N_FOR_PERMIT" for such proposa	to a different reservoir. Is	- -
SUBMIT IN TRIPLICATE			If Unit or CA, Agreement Designation
Type of Well			
X Oil Gas Oil Well Oil	INJECTION ther		
Name of Operator			SEMU Permian
CONOCO, INC.			9. API Well No
Address and Telephone No.			
10 Desta Dr., Suite 100W, Midland, TX 79705-4500, 915 686-5424 or 915 684-6381			30 025 33895 10 Field
Location of Well (Footage, Sec., T.,	R., M., or Survey Description)		Skaggs Grayburg/SA-Wildcat
Surface: 660 FNL & 1960' FEL Location: Sec 25, T205, R37E			11. County or Parish, State
TD: Same			Lea County, NM
CHECK APPROPRIA	TE BOX(s) TO INDICATE NAT	URE OF NOTICE, REPORT, C	OR OTHER DATA
TYPE OF SUBMISS	TYPE OF ACTION		
Notice of Intent		Abandonment	Change of Plans
and the second sec		Recompletion	New Construction
X Subsequent Repo	rt :	Plugging Back	Non-Routine Fracturing
		Casing Repair	Water Shut-Off
Final Abandonmer	nt Notice	Altering Casing	Conversion to Injection
		X Other, New completion/T/A'd	Dispose Water Note Report results of multiple completion on Well
			Completion or Recompletion Report and Log form.)
Describe Proposed or Completed O directionally drilled give subsurfi	perations (Clearly state all pertinent details) ar ace locations and measured and true vertical o	id give pertinent dates, including estimated c lepths for all markers and zones pertinent to	ate of starting any proposed work. If well is
directionally drilled give subsum	ace locations and measured and true vertical c	lepths for all markers and zones pertment to	ate of starting any proposed work. If well is this work)*
7-22-97: PBTD: 4253',	ran GR/CCL from 2500-4253'.	lepths for all markers and zones pertinent to Perforate San Andres 4!70-4!80	ate of starting any proposed work. If well is this work)*
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & s 7-28-97: Set packer @	, ran GR/CCL from 2500-4253'. craper on 2 3/8" tubing to 4150', 0 0 4002', acidize San Andres w/10	lepths for all markers and zones pertinent to Perforate San Andres 4!70-4!80 POH, start GIH w/treating pkr.	ate of starting any proposed work. If well is this work)* 0' w/2 SPF.
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & s 7-28-97: Set packer @ 7-29-97: Finish in hole	, ran GR/CCL from 2500-4253'. craper on 2 3/8" tubing to 4150', 1 0 4002', acidize San Andres w/10 with rods & pump.	lepths for all markers and zones pertinent to Perforate San Andres 4!70-4!80 POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing	tate of starting any proposed work. If well is this work)' O' w/2 SPF. I, land tbg @ 4188'.
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & s 7-28-97: Set packer @ 7-29-97: Finish in hole & II-97: POH w/rods &	ace locations and measured and true vertical of , ran GR/CCL from 2500-4253'. craper on 2 3/8" tubing to 4150', 1 § 4002', acidize San Andres w/10 with rods & pump. pump, POH w/prod tubing, GIH	Perforate San Andres 4!70-4!80 POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', SIOI	ate of starting any proposed work. If well is this work)' O' w/2 SPF. I, land tbg @ 4188'. N.
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & s 7-28-97: Set packer @ 7-29-97: Finish in hole & II-97: POH w/rods & 8-I2-97: Spot cement c	, ran GR/CCL from 2500-4253'. craper on 2 3/8" tubing to 4150', 1 9 4002', acidize San Andres w/10 with rods & pump. pump, POH w/prod tubing, GIH on plug w/bailer, perforate Grayb	lepths for all markers and zones pertinent to Perforate San Andres 4!70-4!80 POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', SIOI urg w/I SPF from 3788-3890'. I	ate of starting any proposed work. If well is this work)' O' w/2 SPF. I, land tbg @ 4188'. N.
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & s 7-28-97: Set packer @ 7-29-97: Finish in hole & II-97: POH w/rods & 8-I2-97: Spot cement o w/treating pkr 8-I3-97: Frac Grayburg	ace locations and measured and true vertical of craper on 2 3/8" tubing to 4150', 1 4002', acidize San Andres w/10 with rods & pump. pump, POH w/prod tubing, GIH on plug w/bailer, perforate Grayb to3565', acidize Grayburg w/20 g w/54,450 gals SFG 3500, w/99	Perforate San Andres 4!70-4!80 POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', SIOI urg w/I SPF from 3788-3890'. I 00 gals I5% HCL.	ate of starting any proposed work. If well is this work)" 0' w/2 SPF. 1, land tbg @ 4188'. N. RDWL. Go in hole
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & si 7-28-97: Set packer @ 7-29-97: Finish in hole 8 II-97: POH w/rods & 8-I2-97: Spot cement o w/treating pkr 8-I3-97: Frac Grayburg 8-I4-97: Turned well to	ace locations and measured and true vertical of , ran GR/CCL from 2500-4253'. craper on 2 3/8" tubing to 4150', 1 9 4002', acidize San Andres w/10 with rods & pump. pump, POH w/prod tubing, GIH on plug w/bailer, perforate Grayb to3565', acidize Grayburg w/20 g w/54,450 gals SFG 3500, w/99 flowline to battery.	Perforate San Andres 4!70-4!80 POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', SIOI urg w/I SPF from 3788-3890'. I 00 gals I5% HCL.	ate of starting any proposed work. If well is this work)" 0' w/2 SPF. 1, land tbg @ 4188'. N. RDWL. Go in hole
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & si 7-28-97: Set packer @ 7-29-97: Finish in hole & II-97: POH w/rods & 8-I2-97: Spot cement of w/treating pkr 8-I3-97: Frac Grayburg 8-I4-97: Turned well to 8-I8-97: Clean out to 4I	ace locations and measured and true vertical of , ran GR/CCL from 2500-4253'. craper on 2 3/8" tubing to 4150', 1 9 4002', acidize San Andres w/10 with rods & pump. pump, POH w/prod tubing, GIH on plug w/bailer, perforate Grayb to3565', acidize Grayburg w/20 g w/54,450 gals SFG 3500, w/99 flowline to battery. II5'.	lepths for all markers and zones pertinent to Perforate San Andres 4!70-4!80 POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', SIOI urg w/I SPF from 3788-3890'. I 00 gals I5% HCL. ,000# I6/30 sd and 32,000# SL	ate of starting any proposed work. If well is this work)* 0' w/2 SPF. 1, land tbg @ 4/88'. N. RDWL. Go in hole C.
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & si 7-28-97: Set packer @ 7-29-97: Finish in hole & II-97: POH w/rods & 8-I2-97: Spot cement of w/treating pkr 8-I3-97: Frac Grayburg 8-I4-97: Turned well to 8-I8-97: Clean out to 4I	ace locations and measured and true vertical of , ran GR/CCL from 2500-4253'. craper on 2 3/8" tubing to 4150', 1 9 4002', acidize San Andres w/10 with rods & pump. pump, POH w/prod tubing, GIH on plug w/bailer, perforate Grayb to3565', acidize Grayburg w/20 g w/54,450 gals SFG 3500, w/99 flowline to battery.	lepths for all markers and zones pertinent to Perforate San Andres 4!70-4!80 POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', SIOI urg w/I SPF from 3788-3890'. I 00 gals I5% HCL. ,000# I6/30 sd and 32,000# SL	ate of starting any proposed work. If well is this work)" ", land tbg @ 4188'. N. RDWL. Go in hole C.
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & si 7-28-97: Set packer @ 7-29-97: Finish in hole 8 II-97: POH w/rods & 8-I2-97: Spot cement of w/treating pkr 8-I3-97: Frac Grayburg 8-I4-97: Turned well to 8-I8-97: Clean out to 4I	ace locations and measured and true vertical of , ran GR/CCL from 2500-4253'. coraper on 2 3/8" tubing to 4150', 1 9 4002', acidize San Andres w/l0 with rods & pump. pump, POH w/prod tubing, GIH on plug w/bailer, perforate Grayb to3565', acidize Grayburg w/20 g w/54,450 gals SFG 3500, w/99 flowline to battery. II5'.	lepths for all markers and zones pertinent to Perforate San Andres 4!70-4!80 POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', SIOI urg w/I SPF from 3788-3890'. I 00 gals I5% HCL. ,000# I6/30 sd and 32,000# SL	ate of starting any proposed work. If well is this work)* 0' w/2 SPF. 1, land tbg @ 4/88'. N. RDWL. Go in hole C.
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & s 7-28-97: Set packer @ 7-29-97: Finish in hole & II-97: POH w/rods & 8-I2-97: Spot cement of w/treating pkr 8-I3-97: Frac Grayburg 8-I4-97: Turned well to 8-I8-97: Clean out to 4I 8-I9-97: RUWL, run po 8-26-97: 0 oil, I40 wate	ace locations and measured and true vertical of , ran GR/CCL from 2500-4253'. coraper on 2 3/8" tubing to 4150', 1 9 4002', acidize San Andres w/l0 with rods & pump. pump, POH w/prod tubing, GIH on plug w/bailer, perforate Grayb to3565', acidize Grayburg w/20 g w/54,450 gals SFG 3500, w/99 flowline to battery. II5'.	lepths for all markers and zones pertinent to Perforate San Andres 4!70-4!80 POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', SIOI urg w/I SPF from 3788-3890'. I 00 gals I5% HCL. ,000# I6/30 sd and 32,000# SL ing, land tbg w/SN@ 3970', GI	ate of starting any proposed work. If well is this work)" ", land tbg @ 4/88'. N. RDWL. Go in hole C.
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & s 7-28-97: Set packer @ 7-29-97: Finish in hole & II-97: POH w/rods & 8-I2-97: Spot cement of w/treating pkr 8-I3-97: Frac Grayburg 8-I4-97: Turned well to 8-I8-97: Clean out to 4I 8-I9-97: RUWL, run po 8-26-97: 0 oil, I40 wate	ace locations and measured and true vertical of , ran GR/CCL from 2500-4253'. craper on 2 3/8" tubing to 4150', 1 9 4002', acidize San Andres w/10 with rods & pump. pump, POH w/prod tubing, GIH on plug w/bailer, perforate Grayb to 3565', acidize Grayburg w/20 g w/54,450 gals SFG 3500, w/99 flowline to battery. II5'. set-treatment log, GIH w/prod tub er. 9 mcf gas.	lepths for all markers and zones pertinent to Perforate San Andres 4!70-4!80 POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', SIOI urg w/I SPF from 3788-3890'. f 00 gals I5% HCL. 000# I6/30 sd and 32,000# SL ing, land tbg w/SN@ 3970', Gl	ate of starting any proposed work. If well is this work)* 0' w/2 SPF. 1, land tbg @ 4/88'. N. RDWL. Go in hole C. H w/rods & pump.
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & s 7-28-97: Set packer @ 7-29-97: Finish in hole & II-97: POH w/rods & 8-I2-97: Spot cement of w/treating pkr 8-I3-97: Frac Grayburg 8-I4-97: Turned well to 8-I8-97: Clean out to 4I 8-I9-97: RUWL, run po 8-26-97: 0 oil, I40 wate	and Reference in the state of t	lepths for all markers and zones pertinent to Perforate San Andres 4!70-4!80 POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', SIOI urg w/I SPF from 3788-3890'. f 00 gals I5% HCL. 000# I6/30 sd and 32,000# SL ing, land tbg w/SN@ 3970', Gl	<pre>// integration of starting any proposed work. If well is this work)* O' w/2 SPF. a, land tbg @ 4/88'. N. RDWL. Go in hole C. H w/rods & pump. //9</pre>
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & s 7-28-97: Set packer @ 7-29-97: Finish in hole & II-97: POH w/rods & 8-I2-97: Spot cement of w/treating pkr 8-I3-97: Frac Grayburg 8-I4-97: Turned well to 8-I8-97: Clean out to 4I 8-I9-97: RUWL, run po 8-26-97: 0 oil, I40 wate	and Revertients and measured and true vertical of , ran GR/CCL from 2500-4253'. craper on 2 3/8" tubing to 4150', 1 9 4002', acidize San Andres w/10 with rods & pump. pump, POH w/prod tubing, GIH on plug w/bailer, perforate Grayburg w/20 to 3565', acidize Grayburg w/20 g w/54,450 gals SFG 3500, w/99 flowline to battery. II5'. I	lepths for all markers and zones pertinent to Perforate San Andres 4!70-4!80 POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', SIOI urg w/I SPF from 3788-3890'. I 00 gals I5% HCL. 000# I6/30 sd and 32,000# SL ing, land tbg w/SN@ 3970', Gl	ate of starting any proposed work. If well is this work)* 0' w/2 SPF. 1, land tbg @ 4/88'. N. RDWL. Go in hole C. H w/rods & pump.
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & s 7-28-97: Set packer @ 7-29-97: Finish in hole & II-97: POH w/rods & 8-I2-97: Spot cement of w/treating pkr 8-I3-97: Frac Grayburg 8-I4-97: Turned well to 8-I8-97: Clean out to 4I 8-I9-97: RUWL, run po 8-26-97: 0 oil, I40 wate	ace locations and measured and true vertical of , ran GR/CCL from 2500-4253'. craper on 2 3/8" tubing to 4150', 1 9 4002', acidize San Andres w/10 with rods & pump. pump, POH w/prod tubing, GIH on plug w/bailer, perforate Grayb to 3565', acidize Grayburg w/20 g w/54,450 gals SFG 3500, w/99 flowline to battery. II5'. est-treatment log, GIH w/prod tub er. 9 mcf gas.	lepths for all markers and zones pertinent to Perforate San Andres 4!70-4!8! POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', S!O! urg w/I SPF from 3788-3890'. I 00 gals I5% HCL. 000# I6/30 sd and 32,000# SL ing, land tbg w/SN@ 3970', GI	<pre>// Interfact Section 2013/2014/2014/2014/2014/2014/2014/2014/2014</pre>
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & s 7-28-97: Set packer @ 7-29-97: Finish in hole & II-97: POH w/rods & 8-I2-97: Spot cement of w/treating pkr 8-I3-97: Frac Grayburg 8-I4-97: Turned well to 8-I8-97: Clean out to 4I 8-I9-97: RUWL, run po 8-26-97: 0 oil, I40 wate	ace locations and measured and true vertical of , ran GR/CCL from 2500-4253'. craper on 2 3/8" tubing to 4150', 1 9 4002', acidize San Andres w/10 with rods & pump. pump, POH w/prod tubing, GIH on plug w/bailer, perforate Grayb to 3565', acidize Grayburg w/20 g w/54,450 gals SFG 3500, w/99 flowline to battery. II5'. est-treatment log, GIH w/prod tub er. 9 mcf gas.	lepths for all markers and zones pertinent to Perforate San Andres 4!70-4!8! POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', S!O! urg w/I SPF from 3788-3890'. I 00 gals I5% HCL. 000# I6/30 sd and 32,000# SL ing, land tbg w/SN@ 3970', GI	<pre>// is work of starting any proposed work. If well is this work of the wor</pre>
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & s 7-28-97: Set packer @ 7-29-97: Finish in hole & II-97: POH w/rods & 8-I2-97: Spot cement of w/treating pkr 8-I3-97: Frac Grayburg 8-I4-97: Turned well to 8-I8-97: Clean out to 4I 8-I9-97: RUWL, run po 8-26-97: 0 oil, I40 wate I hereby certify that the foregoing is Signed	ace locations and measured and true vertical of , ran GR/CCL from 2500-4253'. , craper on 2 3/8" tubing to 4150', 1 9 4002', acidize San Andres w/10 with rods & pump. pump, POH w/prod tubing, GIH on plug w/bailer, perforate Grayb to 3565', acidize Grayburg w/20 g w/54,450 gals SFG 3500, w/99 flowline to battery. II5'. est-treatment log, GIH w/prod tub er. 9 mcf gas.	Perforate San Andres 4!70-4!8! POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', SIOI urg w/I SPF from 3788-3890'. I 00 gals I5% HCL. 000# I6/30 sd and 32,000# SL ing, land tbg w/SN@ 3970', GI n for evaluation)	late of starting any proposed work. If well is this work)* O' w/2 SPF. I, land tbg @ 4/88'. N. RDWL. Go in hole C. H w/rods & pump. Date 11-20-97
7-22-97: PBTD: 4253', 7-25-97: GIH w/bit & s 7-28-97: Set packer @ 7-29-97: Finish in hole & II-97: POH w/rods & 8-I2-97: Spot cement of w/treating pkr 8-I3-97: Frac Grayburg 8-I4-97: Turned well to 8-I8-97: Clean out to 4I 8-I9-97: RUWL, run po 8-26-97: 0 oil, I40 wate I hereby certify that the foregoing is Signed	ace locations and measured and true vertical of , ran GR/CCL from 2500-4253'. craper on 2 3/8" tubing to 4150', 10 9 4002', acidize San Andres w/10 with rods & pump. pump, POH w/prod tubing, GIH on plug w/bailer, perforate Grayb to 3565', acidize Grayburg w/20 g w/54,450 gals SFG 3500, w/99 flowline to battery. II5'. sst-treatment log, GIH w/prod tub er. 9 mcf gas.	Perforate San Andres 4!70-4!8! POH, start GIH w/treating pkr. 00 gallons I5% HCL, ran tubing w/CIBP, set plug @ 4!50', SIOI urg w/I SPF from 3788-3890'. I 00 gals I5% HCL. 000# I6/30 sd and 32,000# SL ing, land tbg w/SN@ 3970', GI n for evaluation)	late of starting any proposed work. If well is this work)* O' w/2 SPF. I, land tbg @ 4/88'. N. RDWL. Go in hole C. H w/rods & pump. Date 11-20-97