

**ATTACHMENT TO FORM C-103
COLLINS & WARE, INC.
DIAMONDBACK #1**

- 3/15/98** Run GR/CET from 7000'-5600'. Found excellent bond across all Blinebry area. Set 5 1/2" CIBP at 6600'. Perf lower Blinebry from 6404-08 and 6516-20 with 1 JSPF (10 holes). AT perfs 6516-20 with 450 gals 15% Ferchek acid with 8 ball sealers. Acid treat 6404 - 6520 with 750 gals 15% Ferchek acid and 20 ball sealers.
- 3/18/98** Perf Upper Blinebry from 5979 - 88, 6030-40, 6096-6115, 6150-58, 1 JSPF, 4" gun, 50 holes. Acidize with 800 gals 15% Ferchek acid and 16 ball sealers. Achieved ballout. Set RBP at 6120 and packer at 6078. Acidize with 1200 gals Ferchek acid and 40 ball sealers. Achieved ball out. Move RBP to 6078 and packer at 6113. Break top perfs with 2000 gals 15% Ferchek acid with 38 ball sealers. Reset RBP at 6188 and packer at 6113'.
- 3/19/98** Frac Blinebry perfs 5979-6158 with 1340 bbls Delta Frac and 1500 sx 20/40 sand.
- 3/20/98** Run 2 3/8" tubing and set Perma Latch packer at 5909'. Begin swabbing.