Submit 3 Copies to Appropriate District Office

State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1/1/89

OIL CONSERVATION	ON DIVISI	ON			
DISTRICT I 2040 Pacheco	St.	WELL	API NO. 5-03390		
1625 N. French Dr., Hobbs, NM 88240 Santa Fe, NM 87 DISTRICT II	1505		cate Type of Lease		
P.O. Drawer DD, Artesia, NM 88210			STA	TE K	E
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410		6. Stat B140	e Oil & Gas Lease No. 0		
			。 ////////////////////////////////////		/////
SUNDRY NOTICES AND REPORTS ON WE (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN DIFFERENT RESERVOIR. USE "APPLICATION FOR PE (FORM C-101) FOR SUCH PROPOSALS.)	NOR PLUG BACK	TO A 7. Leas	e Name or Unit Agree	ment Name	
1. Type of Well:					
OIL GAS WELL OTHER		State			
2. Name of Operator Citation Oil & Gas Corp.		8. Well 2	NO.		
3. Address of Operator			name or Wildcat		<u></u>
P.O. Box 690688, Houston, Texas 77269-0688		Eumo	ont Yates Seven F	livers Queen	gas
Unit Letter X : 990 Feet From The South		330	Feet From The	East	Line
Section 1 Township 21S	Range 35E			l ////////////////////////////////////	County
10. Elevation (Show whethe 3380' DF	r DF, KKB, KI, GK, e	elc)			
11. Check Appropriate Box to Indicate	e Nature of No	tice, Repor	t, or Other Data	l	
NOTICE OF INTENTION TO:			IENT REPOR		
PERFORM REMEDIAL WORK PLUG AND ABANDON		чĸ		G CASING	Г
				D ABANDONMEN	л Г
	COMMENCE DR	CILLING OPINS.		D YOYINDONINICI	
TEMPORARILY ABANDON					Ľ
PULL OR ALTER CASING	CASING TEST A	ND CEMENT JO			·· _
PULL OR ALTER CASING OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent detail work) SEE RULE 1103.	CASING TEST AI OTHER:	t dates, including	B		[
PULL OR ALTER CASING OTHER: 12. Describe Proposed or Completed Operations <i>(Clearly state all pertinent detail)</i>	CASING TEST AI OTHER: ils. and give pertinent BOP. RIH, tag MA joint. Left D bailer and RIH of tubing (SN) to	dates. including ged 111' of fi casing open H with notche o 3675'. RIH	B B estimated date of star Il @3569' (perfs 3 to battery overni ed collar and SN 6 with completion	3050' - 3605'). ght. RIH with on 110 jts 2-3/	[
PULL OR ALTER CASING OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent detail work) SEE RULE 1103. MIRU. POOH with rods & pump. ND pumping tee & NU POOH with 2-3/8" tubing. Noted 2' frac sand recovered in bailer on sandline. Cleaned out 7" casing 3569' - 3650'. RI tubing to 3493'. FIH, tagged PBTD @3691'. PU with end @3624'; end of tbg @3662'. RIH with pump & rods - well Thereby certify that the information above is trie and complete to the best of my knowledge and be a state of the detail of the d	CASING TEST AI OTHER: ils. and give pertinent BOP. RIH, tag MA joint. Left D bailer and RIH of tubing (SN) to pumping to batt	dates. including ged 111' of fi casing open H with notche o 3675'. RIH	B B estimated date of star Il @3569' (perfs 3 to battery overni ed collar and SN 6 with completion RDMO.	3050' - 3605'). ght. RIH with on 110 jts 2-3/	h sand '8''
PULL OR ALTER CASING OTHER: 12. Describe Proposed or Completed Operations /Clearly state all pertinent detail work) SEE RULE 1103. MIRU. POOH with rods & pump. ND pumping tee & NU POOH with 2-3/8'' tubing. Noted 2' frac sand recovered in bailer on sandline. Cleaned out 7'' casing 3569' - 3650'. RI tubing to 3493'. FIH, tagged PBTD @3691'. PU with end @3624'; end of tbg @3662'. RIH with pump & rods - well Thereby certify that the information above is true and complete to the best of my knowledge and be and the additional action.	CASING TEST AI OTHER: ils. and give pertinent BOP. RIH, tag MA joint. Left D bailer and RIH of tubing (SN) to pumping to batt	dates, including ged 111' of fi casing open H with notche o 3675'. RIH tery 3/24/99.	B B estimated date of star Il @3569' (perfs 3 to battery overni ed collar and SN 6 with completion RDMO.	3050' - 3605'). ght. RIH with on 110 jts 2-3/ assembly - SN 10/12/00	h sano /8''
PULL OR ALTER CASING OTHER: 12. Describe Proposed or Completed Operations /Clearly state all pertinent detail work) SEE RULE 1103. MIRU. POOH with rods & pump. ND pumping tee & NU POOH with 2-3/8" tubing. Noted 2' frac sand recovered in bailer on sandline. Cleaned out 7" casing 3569' - 3650'. RI tubing to 3493'. FIH, tagged PBTD @3691'. PU with end f@3624'; end of tbg @3662'. RIH with pump & rods - well Thereby certify that the information above is true and complete to the best of my knowledge and be SIGNATURE	CASING TEST AI OTHER: ils. and give pertinent BOP. RIH, tag MA joint. Left D bailer and RIH of tubing (SN) to pumping to batt	ged 111' of fi casing open H with notche o 3675'. RIH tery 3/24/99.	B B B B B B B B B B B B B B B B B B B	3050' - 3605'). ght. RIH with on 110 jts 2-3/ assembly - SN 10/12/00	h sano /8''
PULL OR ALTER CASING OTHER: 12. Describe Proposed or Completed Operations /Clearly state all pertinent detail work) SEE RULE 1103. MIRU. POOH with rods & pump. ND pumping tee & NU POOH with 2-3/8'' tubing. Noted 2' frac sand recovered in bailer on sandline. Cleaned out 7'' casing 3569' - 3650'. RI tubing to 3493'. FIH, tagged PBTD @3691'. PU with end @3624'; end of tbg @3662'. RIH with pump & rods - well I hereby certify that the information above is true and complete to the best of my knowledge and be SIGNATURE TYPE OR PRINT NAME Debra Harri (This space for State Use)	CASING TEST AI OTHER: ils. and give pertinent BOP. RIH, tag MA joint. Left D bailer and RIH of tubing (SN) to pumping to batt	dates, including ged 111' of fi casing open H with notche o 3675'. RIH tery 3/24/99.	B B B B B B B B B B B B B B B B B B B	3050' - 3605'). ght. RIH with on 110 jts 2-3/ assembly - SN 10/12/00	h sano /8''