

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-101  
Revised 10-1-78

|                        |  |
|------------------------|--|
| NO. OF COPIES RECEIVED |  |
| DISTRIBUTION           |  |
| SANTA FE               |  |
| FILE                   |  |
| U.S.G.S.               |  |
| LAND OFFICE            |  |
| OPERATOR               |  |

5a. Indicate Type of Lease  
State ☒ Fee ☐

5. State Oil & Gas Lease No.  
E-8241

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☒ GAS WELL ☒ OTHER ☐

2. Name of Operator  
Ernie L. Hegwer

Address of Operator  
P.O. Box 24 Hobbs, New Mexico 88240

4. Location of Well  
UNIT LETTER A 660 FEET FROM THE North LINE AND 660 FEET FROM  
THE East LINE, SECTION 3 TOWNSHIP 21S RANGE 35E NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)  
3588GL

7. Unit Agreement Name

A

8. Farm or Lease Name

State 334

9. Well No.

No. 1

10. Field and Pool, or Wildcat

Eumont Yates

12. County  
Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: (SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐

PLUG AND ABANDON ☐  
CHANGE PLANS ☐  
OTHER ☐

REMEDIAL WORK ☒  
COMMENCE DRILLING OPS. ☐  
CASING TEST AND CEMENT JOBS ☐  
OTHER ☐

ALTERING CASING ☐  
PLUG AND ABANDONMENT ☐  
OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

6/11/84 Rig up Baber Well Service, trip rods & tubing out, run bridge plug & set @ 3820' pull up 1 jt. set packer. Pressure up on bridge plug to 1,000#. Release packer trip out. Perforate at following intervals; 3740-3760, 3768-3770, & 3786-3796. (2) Two shots per foot, total 66 shots. Run packer in hole set @ 3600' acidize with 1,000 gals. 15% NEFE acid with clay stabilizer, flush with 25 Bbls. 2% KCL. Instant shut-in 1200#, 5 min. 950#, 15 min. 800#. Swab back recover 5 Bbls. Shut rig down.

6/12/84 Run in hole with swab line 100' of fluid entry. No pressure. Recover bridge plug & packer, run rods & tubing, hang well off. Rig down.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Operator/Owner

DATE 6/19/84

ORIGINAL SIGNED BY JERRY SEXTON  
DISTRICT SUPERVISOR

APPROVED BY \_\_\_\_\_

TITLE \_\_\_\_\_

DATE JUN 26 1984

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED  
JUN 22 1984  
O C D  
HOESS OFFICE