

EMSU # 269
API # 30-025-04445
660' FSL & 660' FEL
S2, T21S, R36E, & Unit ~~4~~
Eunice Monument South Unit
Lea County, New Mexico

February 22, 2001

PROCEDURE TO TEMPORARILY ABANDON WELL:

Notify OCD/BLM 24 hrs prior to work commencing.

1. Verify anchors have been set & tested.
2. MIRU PU. ND WH. NU BOP.
3. TOH w/ tbg. TIH w/ 6-1/8" bit, csg scraper, & WS. Make bit trip to 3667'. POH.
4. Set CIBP @ 3650'. Dump 3 sx Class 'C' cmt on CIBP. TOH. WOC.
5. TIH w/WS to TOC. Circulate csg w/corrosion inhibited pkr fluid. TOH.
6. Perform MIT (500 PSI for 30 min.).
7. ND BOP. NU WH. RD PU.
8. Clean and clear location.

Tracy Love 687-7645