

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-7

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.

SUNDARY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☐ GAS WELL ☐ OTHER ☐
Name of Operator
AMOCO PRODUCTION COMPANY
Address of Operator
P. O. Box 68, Hobbs, NM 88240
Location of well
UNIT LETTER X 660 FEET FROM THE East LINE AND 660 FEET FROM
THE South LINE, SECTION 2 TOWNSHIP 21-S RANGE 36-E NMPM.

7. Unit Agreement Name
8. Farm or Lease Name
State "C" Tract 11
9. Well No.
1
10. Field and Pool, or wildcat
Eumont Monumt GB/SA
12. County
Lea

15. Elevation (Show whether DF, RT, GR, etc.)
3527' GL

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
CULL OR ALTER CASING ☐
OTHER ☐
PLUG AND ABANDON ☐
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:
REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOB ☐
OTHER turn wellbore over to Chevron
ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MI and RUSU 1-30-87. Kill well with 50 BLW. Run Baker cement retainer and set at 2582. Squeeze 100 sx Class C 3/10 of 1% Hallid 9 300 sx class C. Max squeeze at 1000#. reverse out 65 sx cement. RIH with 6-1/4" bit and 8-4-1/8" drill collars. Tag cement 2578 ft. Drill out cement from 2578-2582. Drill out cement retainer from 2582-2585. Drill cement 2585 to 2611. Drill out 2611 to 2711. Circulate hole clean. Drill out cement from 2711 to 2774. Pressure test to 500# and OK. Drill out cement from 2774-3110 and test to 500# and OK. Drill out cement from 3110 ft to 3147. RIH 6-1/4" bit 8 4-1/8" drill collars. Drill out junk at 3544. Drill out cement to 3610 and test to 500# and OK. Drill out cement from 3610 to 3620. Drill out cement retainer. Drill out from 3622 to 3757. Circulate hole clean. Drill out from 3757 to 3854. Circ hole clean. Seating nipple and land at 3399. RD and MOSU 2-6-87.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

by S. Brownlee TITLE Administrative Analyst DATE 2-11-87

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT 1 SUPERVISOR

COPIES OF APPROVAL, IF ANY: TITLE DATE

FEB 16 1987