

Evans State #3

WBS UWPWB- A0007-ABN

API: 30-025-04449
Eumont/Jalmat Pool
Lea County, New Mexico
Thursday, November 30, 2000

Procedure to Plug & Abandon

Notify OCD 24 hrs prior to operations.

1. This procedure will P & A the Evans State #3.
2. MIRU PU. ND WH. NU BOP.
3. RIH w/ WS.
4. RU Sierra. Set CIBP @ 2575' (100' above top perf @ 2666'). Dump Bail 35' of cmt. Tag plug.
5. Perf @ 1330'. Sqz 185' inside & 185' outside 5.5" Csg (top of salt & shoe). Bring cmt to 1145'. Tag plug.
6. Spot 10 sx Class C cmt plug from 77' to surf. RD Sierra. WOC.
7. ND BOP. RD PU.
8. ND wellhead. Cut off casing 4' below GL & cap.
9. Install 4" marker 4' above GL w/ the following stamped on it:

Chevron U.S.A. Inc.
Evans State #3
3897 FNL & 1319 FEL
T-21-S, R-36-E, Sec. 3, Unit P
Lea County, NM

Casing	Depth
Intermediate Csg	8.625" @ 1195'
Production Csg	5.5" @ 3587'
Formation Tops	Depth
Top of Salt	1330'
Yates	2664'
7 Rivers	2926'
Queen	3372'
Penrose	3492'

10. Remove all eqp., deadmen, and junk from location.
11. Fill any pits and level location.

Class C Cement: (198 sx)
1% CaCl (Cement Accelerator)
0.5 BA-10 (Fluid Loss Additive)
0.3 CD-32 (Cement Dispersant)

9.5# Brine w/ 25# of gel per BBL: (48 BBL w/ 1287.5 # of gel)

CJ Affeld
Petroleum Engineer
CTN 687-7271
HM 915 694 – 3884