

Meyer B-4 #14

30-025-04474

Recommendation to Temp. Abandon

This well is currently inactive. It is recommended that the well be temporarily abandoned while evaluating further up-hole potential.

1. POOH rods & tubing.
2. Make scraper run inside 5.5", 17# casing to 2651'.
3. Set Cast Iron Bridge Plug w/in 50' of end of casing @ 2601', spot 35' cmt on top of CIBP.
4. Circulate Casing with inhibited packer fluid.
5. Pressure test casing to 500# for 30 minutes. Give OCD 24 hrs notice prior to pressure test.