

EMSU # 218
API # 30-025-04657
3300' FNL & 1980' FWL
S6, T21S, R36E, & Unit ~~11K~~
Eunice Monument South Unit
Lea County, New Mexico

February 20, 2001

PROCEDURE TO TEMPORARILY ABANDON WELL:

Notify OCD/BLM 24 hrs prior to work commencing.

1. Verify anchors have been set & tested.
2. MIRU PU. ND WH. NU BOP.
3. TOH w/ tbg. TIH w/ 6-1/8" bit, csg scraper, & WS. Make bit trip to 3600'. POH.
4. TIH w/WS to 3504'. Spot 100' balanced Class 'C' cmt plug from 3575' to 3475'.
TOH. WOC.
5. TIH w/WS to TOC. Circulate csg w/corrosion inhibited pkr fluid. TOH.
6. Perform MIT (500 PSI for 30 min.).
7. ND BOP. NU WH. RD PU.
8. Clean and clear location.

Tracy Love 687-7645