

EMSU # 218
API # 30-025-04657
3300' FNL & 1980' FWL
S6, T21S, R36E, & Unit 11
Eunice Monument South Unit
Lea County, New Mexico

February 20, 2001

PROCEDURE TO TEMPORARILY ABANDON WELL:

Notify OCD/BLM 24 hrs prior to work commencing.

1. Verify anchors have been set & tested.
2. MIRU PU. ND WH. NU BOP.
3. TOH w/ tbg. TIH w/WS to 3600'.
4. Spot 100' balanced Class 'C' cmt plug from 3605' to 3505'.
TOH. WOC.
5. TIH w/WS to TOC. Circulate csg w/corrosion inhibited pkr fluid. TOH.
6. Perform MIT (500 PSI for 30 min.).
7. ND BOP. NU WH. RD PU.
8. Clean and clear location.

Tracy Love 687-7645

Corrected