

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		5. LEASE DESIGNATION AND SERIAL NO. LC031740A
2. NAME OF OPERATOR Chevron U.S.A. Inc.		6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR P.O. Box 670, Hobbs, New Mexico 88240		7. UNIT AGREEMENT NAME Eunice Monument South U
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 660' FSL and 1980' FWL		8. FARM OR LEASE NAME
14. PERMIT NO.	15. ELEVATIONS (Show whether OF, FT, GL, etc.) 3658'	9. WELL NO. 418
		10. FIELD AND POOL, OR WILDCAT Eunice Monument G/SA
		11. SEC., T., R., & OR BLK. AND SURVEY OR AREA Sec.17,T21S,R36E
		12. COUNTY OR PARISH Lea
		13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
(Other) ☐

PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
ABANDON* ☐
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐
FRACTURE TREATMENT ☐
SHOOTING OR ACIDIZING ☐
(Other) dpn, acdz

REPAIRING WELL ☐
ALTERING CASING ☐
ABANDONMENT* ☒

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Work performed 12-12-87 through 12-16-87

TD: 4191 PB: 4125'

POH w/pmp equip. Change out wellhead to National. Test to 600psi, ok. Cleanout fill f/3995' to 4013'. Drill cmt f/4013' to 4125'. Circ clean. Set pkr at 3778', acdz w/3500 gallons 15% NEFE HCL, Flush to bottom of OH w/ 29bbls BW. Swab. RIH w/ 2 3/8" 4.7#, J-55, 8rd tbg, set at 3927'. Run pmp and rods, test pmp to 500psi, ok. Turn over to production 12-16-87.

RECEIVED
FEB 18 11 07 AM '88

18. I hereby certify that the foregoing is true and correct

SIGNED M. E. Morris

TITLE Staff Drilling Engineer DATE Feb. 16, 1988

(This space for Federal or State office use)

APPROVED BY _____

TITLE _____

DATE _____

CONDITIONS OF APPROVAL, IF ANY:

FEB 14 1988

*See Instructions on Reverse Side

SJS
CROWLEY, NEW MEXICO

RECEIVED

MAR 14 1988

OCD
HOBBS OFFICE