

 
RECOMMENDED PLUG AND ABANDON PROCEDURE

1. Notify NMOCC of intent to plug and abandon.
2. Pull and lay down rods and pump.  
Check for tubing leak.
3. Pull tubing up and spot Class "C" cement plugs as follows:

<u>Sx</u>	<u>Depth</u>	<u>For</u>
20	3725'-3845'	Above the producing zone
15	2700'-2800'	Below the Salado (top of Yates)
15	1400'-1500'	Between the Salado and the Santa Rosa
15	250'-350'	Below the Ogallala
10	Surface	

Pump all plugs down with mud consisting of 25 sx gel per 100 bbl. brine. Tag all plug tops with pipe.

4. Set well marker and clean up location. Call NMOCC to inspect.

  
S. E. Barker

LNP/sg  
12-19-75