

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-77

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER	7. Unit Agreement Name
2. Name of Operator SHELL WESTERN E&P INC.	8. Farm or Lease Name STATE SECTION 2*
3. Address of Operator P. O. BOX 576, HOUSTON, TEXAS 77001 (WCK 4435)	9. Well No. 2*
4. Location of Well UNIT LETTER <u>L</u> <u>4620</u> FEET FROM THE <u>SOUTH</u> LINE AND <u>660</u> FEET FROM THE <u>WEST</u> LINE, SECTION <u>2</u> TOWNSHIP <u>21-S</u> RANGE <u>37-E</u> N.M.P.M.	10. Field and Pool, or Wildcat DRINKARD
15. Elevation (Show whether DF, RT, GR, etc.) 3491' DF	12. County LEA

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data.
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	EDMENCE DRILLING DEHS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER OPEN BLINEBRY/TUBB, SAND FRAC & ACDZ ☒	CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. *NEW WELL NAME: NORTHEAST DRINKARD UNIT #213

1. POH w/prod equip.
2. Tag PBTB. CO if necessary.
3. Set RBP @ 6550' & tst to 1000#.
4. Set pkr @ 5900'. Tst csg below pkr to 1000# & csg above pkr to 500#. TOH w/pkr.
5. Perf Blinebry/Tubb 6048' - 6438' (1 JSPF).
6. Run base GR/Temp log from 6550' to 5600'.
7. Acdz perfs 6048' - 6438' w/1092 gals 15% HCl-NEA.
8. Sand frac perfs 6048' - 6438' w/42,000 gals x-linked 40# gel + 144,500# 20/40 sd. SI well overnite.
9. Flow back until well dies. CO to RBP.
10. Run GR/Temp Survey from 6550' to 5600'.
11. Perf Blinebry/Tubb 5896' - 6560' (1 JSPF).
12. Acdz Tubb perfs 6538' - 6560' w/2000 gals 15% HCl-NEA + 250# rock salt.
13. Flow back until well dies. Reset RBP @ 6520'.
14. Spot acid from RBP to 5800'.
15. Reset RBP @ 6000'.
16. Acdz Blinebry perfs 5896' - 5977' w/2500 gals 15% HCl-NEA + 250# rock salt.
17. TOH w/RBP.
18. Install prod equip & return well to prod.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED A. J. Fore A. J. FORE TITLE SUPERVISOR REG. & PERMITTING DATE 12-17-87

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT SUPERVISOR

APPROVED BY _____ TITLE _____ DATE DEC 28 1987

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

DEC 23 1987

MAIL
ROOMS OFFICE

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES DESIRED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

3a. Indicate Type of Lease
State ☒ Fee ☐
3. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Name of Operator SHELL WESTERN E&P INC.	7. Unit Agreement Name
2. Address of Operator P. O. BOX 576, HOUSTON, TEXAS 77001 (WCK 4435)	8. Farm or Lease Name STATE SECTION 2
3. Location of Well UNIT LETTER <u>L</u> <u>4620</u> FEET FROM THE <u>SOUTH</u> LINE AND <u>660</u> FEET FROM THE <u>WEST</u> LINE, SECTION <u>2</u> TOWNSHIP <u>21-S</u> RANGE <u>37-E</u> NMPM.	9. Well No. 2
15. Elevation (Show whether DF, RT, GR, etc.) 3491' DF	10. Field and Pool, or Widest DRINKARD
	12. County LEA

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data.
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANE ☐	COMMENCE DRILLING OPER. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	OTHER <u>ACD</u> ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3-07-85: Pulled production equipment. Tagged btm @ 6757'. Spotted 100 gals 15% HCl-NEA across Drinkard OH 6660' - 6757'.

3-08-85: Acid Drinkard OH 6660' - 6757' w/5000 gals 15% HCl-NEA + 2000# rock salt. Acid Drinkard perms 6584' - 6639' w/3000 gals 15% HCl-NEA + 1500# rock salt.

3-09-85: Installed production equipment and returned well to production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED A. J. FORE TITLE SUPERVISOR REG. & PERMITTING DATE APRIL 16, 1986

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE APR 21 1986

RECEIVED
APR 18 1986
O.C.D.
HOBBS OFFICE

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES DESIRED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER

2. Name of Operator
SHELL WESTERN E&P INC.

3. Address of Operator
P. O. BOX 576, HOUSTON, TEXAS 77001 (WCK 4435)

4. Location of Well
UNIT LETTER L 4620 FEET FROM THE SOUTH LINE AND 660 FEET FROM
THE WEST LINE, SECTION 2 TOWNSHIP 21-S RANGE 37-E N.M.P.M.

15. Elevation (Show whether DF, RT, GR, etc.)
3491' DF

7. Unit Agreement Name

8. Farm or Lease Name
STATE SECTION 2

9. Well No.
2

10. Field and Pool, or Wildcat
DRINKARD

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data.
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPER. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	ACID DUMP ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-31-84: Pmpd 45 bbls 20% Titan XL Acid/5 dwn csg to Drinkard perms 6584' - 6639'. Flushed w/150 bbls 2% KCl. Returned well to production.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED A. J. FORE TITLE SUPERVISOR REG. & PERMITTING DATE APRIL 16, 1986

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ DATE APR 21 1986

CONDITIONS OF APPROVAL, IF ANY: