

Procedure cont:

W.W. Weatherly #2

Acdz., perf, Plug Back:

11/16/91

FIH W/SN & 2-3/8" TBG TO 3420/ RU D-S/ SPOT 900 GAL 15% NEFEHCL ACROSS PERFS/ PRESS CSG TO 1000 PSI FOR 3 HRS- PERFS DID NOT BD/ TOH W/TBG/ TIH W/5-1/2" PKR ON 2-3/8" TBG TO 2480/ SET PKR/ BD PERFS @ 2200 PSI/ PUT AWAY @ 1700 PSI/ ISIP 1500 PSI, 15 MIN 0/ -30 BLAW/ SWAB 3 HRS, FL SURF-2400/ REC 0 BO, 22 BLAW/ FE 1 BPH/ LOON TO TT ON 10/64" CHK/ SDFN/ PREP TO TRIP FOR PKR & NU TREE/

11/17/91

NO FLOW OVERNITE/ RLS PKR/ TOH W/TBG & PKR/ TIH W/5-1/2" GUIBERSON UNI-VI PKR W/PUMP-OUT PLUG & ON-OFF TOOL ON 2-3/8" TBG TO 2489/ SET PKR/ ND BOP & NU WH/ SDFN/ PREP TO FRAC MONDAY/ -8 BLAW/

11/18/91

SD/ CREWS OFF/

11/19/91

NU TREE SAVER/ TRAP 1000 PSI ON ANUL/ DWL-SCHL PUMPED 10 GALS 2% KCL WTR F/8 GALS 15% NEFEHCL DOWN 2-3/8" TBG/ PRESSURE 2-3/8" TBG TO 6000 PSI/ COULD NOT SHEAR PUMP-OUT PLUG/ RIH W/SINKER BAR ON WL/ ATTEMPT TO KNOCK OUT PUMP-OUT PLUG W/NO SUCCESS/ POH W/WL & SINKER BAR/ PRESS 2-3/8" TBG TO 4000 PSI & PUMP-OUT PLUG SHEARED/ BEGAN PMP'G N2 & WELL COMMUNICATED TO ANUL/ ND WH/ NU BOP/ UNSEAT PKR & TOH W/2-3/8" TBG & GUIB "UNI-VI" PKR/ TIH W/5-1/2" GUIB "UNI-VI" PKR & SN W/SV IN PLACE ON 2-3/8" TBG TESTING TBG TO 4000 PSI- OK/ FISH SV/ ND BOP/ NU WH/ RESET PKR 1 JT HIGHER @ 2459'/ TRAP 1000 PSI ON ANUL/ DWL-SCHL FRAC EUMONT PERFS 2604-3417' W/200,000 SCF N2 @ 15000 SCF/MIN F/8 1500 GALS 15% NEFEHCL W/2000 SCF/MIN N2 & 150- 7/8" RCN BALL SEALERS F/B 180,000 SCF N2 PUMPED @ 15000 SCF/MIN W/1000 GAL GELLED 2% NEKCL WTR & 2000# 16/20 CARBOLITE PUMPED @ 2 BPM/ SHUT DOWN TO SURGE BALL SEALERS OFF PERFS/ PUMPED ADD'L 180,000 SCF N2 @ 15000 SCF/MIN W/1000 GALS GELLED 2% NEKCL WTR & 2000# 16/20 CARBOLITE PUMPED @ 2 BPM/ FLUSH W/20000 SCF @ 15000 SCF/MIN/ MAX P 6000 PSI/ MIN P 2590 PSI/ AIR 4 BPM @ 3850 PSI/ FP 3550 PSI/ ISIP 2880 PSI/ JC @ 5:30 PM 11/18/91/ TOTAL LOAD TO REC 98 BLW/ OPEN TO FLOW WELL @ 6:00 PM 11/18/91/ 12 HRS/ F/ FTP 2500-0 PSI/ REC 0 BO & 22 BLW/ WELL DEAD/ PREP TO SWAB/ -76 BLW/

11/20/91

SWAB 3 HRS/ FL 600-2300/ REC 0 BO, 11 BLW/ NO FE AFTER 2 HR, NO GAS BLOW/ SI WELL TO BUILD PRESSURE/ RR @ 10:00 AM 11/19/91/ -65 BLW/ RU JARRELL SERVICES/ TAG PBTD @ 3300' W/SLICKLINE/ PERFS 3304 TO 3417 COVERED W/FILL/ RD JARRELL/ LEFT WELL SI/

11/21/91

WELL SHUT IN/ PREP TO MIRU & RESET PKR TO TEST UPPER PERFS/ -65 BLW/

11/22/91

*** FINAL REPORT ***

MIRU PERMIAN WS RIG @ 9:00 AM 11/21/91/ ND WH/ NU BOP/ UNSEAT 5-1/2" PKR/ LWR & RESET PKR @ 2810'/ EIR DOWN ANUL INTO EUMONT PERFS 2604-2782' W/1 BPM @ 1600 PSI/ EIR DOWN 2-3/8" TBG INTO EUMONT PERFS 2928-3417' W/1 BPM @ 1800 PSI/ PERFS ABOVE 7-5/8" CSG SEAT OPEN/ UNSEAT PKR & TOH & LAY DOWN 2-3/8" TBG & PKR/ ND BOP/ NU WH/ -100 BLW/ REL RIG @ 6:00 PM 11/21/91/ TA WELL/ UNSUCCESSFUL WORKOVER/

RECEIVED
DEC 06 1991
OCD
HOBBS OFFICE