

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210DISTRICT III  
1000 Rio Brujos Rd., Aztec, NM 87410

## OIL CONSERVATION DIVISION

P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-06722
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Weatherly Lease
8. Well No. 4
9. Pool name or Wildcat Blinebry/Drinkard
10. Elevation (Show whether DF, RKB, RT, GR, etc.)

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	2. Name of Operator Stephens & Johnson Operating Co.
3. Address of Operator P. O. Box 2249, Wichita Falls, TX 76307-2249	4. Well Location Unit Letter <u>B</u> : <u>660</u> Feet From The <u>North</u> Line and <u>1320</u> Feet From The <u>East</u> Line Section <u>21</u> Township <u>21S</u> Range <u>37E</u> NMPM Lea County
5. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	6. Name of Operator Stephens & Johnson Operating Co.
7. Address of Operator P. O. Box 2249, Wichita Falls, TX 76307-2249	8. Well Location Unit Letter <u>B</u> : <u>660</u> Feet From The <u>North</u> Line and <u>1320</u> Feet From The <u>East</u> Line Section <u>21</u> Township <u>21S</u> Range <u>37E</u> NMPM Lea County
9. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

## NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐  
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐  
PULL OR ALTER CASING ☐  
OTHER: ☐

## SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐  
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER: Perforate additional Blinebry zones & stimulate. Install pumping equipment. ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

10-31-96 Perforated additional Blinebry zone 5580-5600, 5607-13, 5699-5703, 5710-26, 5730-35, 5912-16, 5920-28, 5931-41, 5971-75, 5988-6022, 6154-57, 6160-66, 6170-85, 6207-25'. Return to production

11-11-96 Rig up workover unit. Run RTTS packer & bridge plug. Set BP @6319' and packer @5520'. Treated old & new perms 5580-6225' w/8,250 gals 15% Ferchek acid and fraced perms w/148,000 lbs 20/40 sand and 89,553 gals KCL water.  
Clean well up. Retrieve packer & bridge plug. Run tbg & rods.  
Installed 228 pumping unit and start pumping.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Bob Gilmore TITLE Petroleum Engineer DATE 1/16/97  
(817)  
TYPE OR PRINT NAME Bob Gilmore TELEPHONE NO. 723-2166

(This space for State Use)

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_  
CONDITIONS OF APPROVAL, IF ANY:

JAN 27 1997