

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

2040 South Pacheco
Santa Fe, NM 87505

WELL API NO.
30-025-06734

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS)

7. Lease Name or Unit Agreement Name

Eubank

1. Type of Well:

OIL
WELL ☐

GAS
WELL ☐

OTHER Shut In

2. Name of Operator

Zia Energy, Inc.

8. Well No.

8

3. Address of Operator

PO Box 2510, Hobbs, NM 88241

9. Pool name or Wildcat

Paddock

4. Well Location

Unit Letter G | 1750 Feet From The North Line and 2310 Feet From The East Line

Section 22 Township 21S Rang. 37E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3425

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

REMEDIAL WORK ☐

ALTERING CASING ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☐

PULL OR ALTER CASING ☐

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

GIH and set cement retainer at 5070'. Squeeze 50 sx of cement, sting out of retainer and dump 25 sx on retainer.
(Top of Glorieta)

Cut casing at 3850'. POH with 5 1/2" casing.

Circulate hole with salt gel mud consisting of 10-pound brine with 25 pounds of gel per barrel.

Pump a 200' plug at 3900', 150' above and 50' below casing cut off point. WOC and tag. (Top of San Andres)

Pump a 100' plug at 2850' (Intermediate shoe). ~~WOC and tag.~~

Pump a 100' plug at 1200' (Top of salt section). ~~WOC and tag.~~

Pump a 100' plug at 365' (Surface shoe). ~~WOC and tag.~~

Pump 10 sx at surface.

Cut casing off 3' below surface and weld on dry hole marker.

Cut off anchors and clean location.

THE COMMISSION MUST BE NOTIFIED 24
HOURS BEFORE THE BEGINNING OF
PLANNED OPERATIONS FOR THE C-103
TO BE APPROVED.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Scott Nelson

TITLE

Engineer

DATE 12/1/98

TYPE OR PRINT NAME

Scott Nelson

393-2937

TELEPHONE NO.

(This space for State Use)

APPROVED BY

ORIGINAL SIGNED BY
GARY WINK
FIELD REP. II

TITLE

DATE