		Form C-103
DISTRIBUTION		Supersedes Old C•102 and C-103
SANTA FE	NEW MEXICO OIL CONSERVATION COMMISSION	Effective 1-1-65
FILE		
U.S.G.S.		5a. Indicate Type of Lease
LAND OFFICE		State Fee X
OPERATOR		5. State Oil & Gas Lease No.

SUN	NDRY NOTICES AND REPORTS ON WELLS R PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. ICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)	
1.	TCATION FOR FERMIT = (FORM C+101) FOR SUCH PROPOSALS.)	7. Unit Agreement Name
OIL GAS WELL	OTHER.	
2. Name of Operator		8. Farm or Lease Name
Shell Oil Compan	у	Argo A
3. Address of Operator		9. Well No.
	Midland, Texas 79701	4
4. Location of Well		10. Field and Pool, or Wildcat
UNIT LETTER	1980 FEET FROM THE North LINE AND 1980 FEE	ET FROM Drinkard
** ** - 4*	00	
THE WEST LINE, SI	ECTION 22 TOWNSHIP 21S RANGE 37E	_NMPM. ()
mmmmm	15. Elevation (Show whether DF, RT, GR, etc.)	12, County
	3426 DF	Lea
16. Cha.	ck Appropriate Box To Indicate Nature of Notice, Report	0.1 D
TEMPORARILY ABANDON	COMMENCE DRILLING OFNS.	ALTERING CASING PLUG AND ABANDONMENT
other 17. Describe Proposed or Complete work) SEE RULE 1103. 1. Pulled rods, 2. Perforated 5 3. Acidized per: 4. Acidized per: 5. Fracture tree	change plans CASING TEST AND CEMENT JOB OTHER d Operations (Clearly state all pertinent details, and give pertinent dates, in 6-19-73 to 6-23-73 pump and tubing. 1/2" casing at 6394, 6402, 6406 with 1 JSPF. forations 6394-6450' with 3000 gal. 15% NEA. forations 6394-6406' with 1200 gal. 15% NEA. ated with 20,000 gal. jelled lease crude + 1 1 2" tubing, hung at 6602.	PLUG AND ABANDONMENT
1. Pulled rods, 2. Perforated 5 3. Acidized per: 4. Acidized per: 5. Fracture tree 6. Ran 228 jts. 7. Placed on pro	casing test and cement JQB other d Operations (Clearly state all pertinent details, and give pertinent dates, in 6-19-73 to 6-23-73 pump and tubing. 1/2" casing at 6394, 6402, 6406 with 1 JSPF. forations 6394-6450' with 3000 gal. 15% NEA. forations 6394-6406' with 1200 gal. 15% NEA. ated with 20,000 gal. jelled lease crude + 1 1 2" tubing, hung at 6602. oduction.	PLUG AND ABANDONMENT
1. Pulled rods, 2. Perforated 5 3. Acidized per: 4. Acidized per: 5. Fracture tree 6. Ran 228 jts. 7. Placed on pro	casing test and cement JQB other d Operations (Clearly state all pertinent details, and give pertinent dates, in 6-19-73 to 6-23-73 pump and tubing. 1/2" casing at 6394, 6402, 6406 with 1 JSPF. forations 6394-6450' with 3000 gal. 15% NEA. forations 6394-6406' with 1200 gal. 15% NEA. ated with 20,000 gal. jelled lease crude + 1 1 2" tubing, hung at 6602. oduction.	PLUG AND ABANDONMENT