			, _i	
Submit 3 Copies to Approviate I			}	
Office DISTRICT I	Energy, Minerals and Nat	ural Resouces	FORM C-103	
1625 N. French Dr., Hobbs, NM			Revised March 25, 1999	
DISTRICT II 811 South First, Artesia, NM 88	210 OIL CONSERVATION 1220 South St. France		Well Api No. 30-025-06739	
DISTRICT III	Santa Fe, NM 8		5. Indicate Type of Lease	
1000 Rio Brazos Rd., Aztec, NN DISTRICT IV	1 87410		6. State Oil & Gas Lease No.	
1220 South St. Francis Dr., Sant	a Fe, NM 87505			
SUNDRY NOTICES AND REPORTS ON WELLS			7. Lease Name or Unit Agreement Name	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH			7. Lease Ivalle of Onli Agreement Ivalle	
PROPOSALS.) 1. Type of Well:	······································		Argo A	
	ELL GAS WELL OTHER			
2. Name of Operator			8. Well No.	
Apache Corporatio 3. Address of Operator	<u>n</u>		9. Fool name or Wildcat	
2000 Post Oak Blv	d., Ste. 100, Houston, Texas 77056-4400		Penrose Skelly; Grayburg	
Pat Letter	E : 1880 Fast From The North	Luce and760	Feet From The West Line	
Section 22 Township 21S Rauge 37E NMPM Lea County				
	10. Elevation (Show whether DF, RKB, R 3421' GR	I, GR, etc.)		
11. NO	Check Appropriate Box to			
	TICE OF INTENTION TO:	_	BSEQUENT REPORT OF:	
Perform Remedi	al Work 🔲 Plug and Abandon	Remedial Wor	k 🗌 Altering Casing	
Temporarily Abandon			rilling Operations	
Pull or Alter Cas	ing	Casing Test a	nd Cement Job	
Other		✓ Other	Plugback to Grayburg	
 Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinen: dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 				
5/29/2001	MIRU and pull out of hole w/ production equipment. Run in hole w/ bit & scraper to 6800'. Run in hole w/ CIBP and set @ 6698' w/ 35' cement. Pressure test to 500# - Held OK			
5/30/2001	Run in hole w/ CIBP and set @ 5464' w/ 35' cement. Run Cement Bond Log from 3300' - 4300'. Top of cement @ 3630'.			
5/31/2001	Perforate Grayburg 3812-3820, 3834-3840, 3848-3860, 3866-3888, 3896-3904, 3912-3960. Acidize Grayburg 3812 - 3960 w/ 5000 gals 15% HCL			
6/4/2001	Frac Grayburg 3812 - 3960 w/ 27000 gals gel & 50460# 16/30 sand			
6/5/2001	Run in hole and clean out sant to 4150'. Circulate hole clean			
6/6/2001	Run in hole w/ 2-3/8" production tubing and set @ 4016'. Return well to production			
I hereby certify that the inform SIGNATURE	nation dowe is true and complete to the best of my knowledge and belief.	mle Sr. Engi	neering Technician DATE 7/31/2001	
TYPE OR PRINT NAME	Debra J. Anderson		TELEPHONE NO. 713-296-6338	
(This space for State Use)	TITLE	نظريار در ديدو مرير	DATE	

5	CONDITIONS OF APPROVAL, IF ANY:
(-

min. + Dha

ķ