

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- 2. Name of Operator SHELL WESTERN E&P INC. 3. Address of Operator P. O. BOX 576, HOUSTON, TX 77001 (WCK 4435) 4. Location of Well UNIT LETTER L 1740 FEET FROM THE SOUTH LINE AND 350 FEET FROM THE WEST LINE, SECTION 22 TOWNSHIP 21-S RANGE 37-E N.M.P.M. 15. Elevation (Show whether DF, RT, GR, etc.) 3430' DF	7. Unit Agreement Name 8. Farm or Lease Name TURNER 9. Well No. 8 10. Field and Pool, or Wildcat DRINKARD HARE SIMPSON 12. County LEA
---	--

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data.
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPERATIONS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER SQZD DRINKARD; ACD HARE SIMPSON <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

11-06-87: POH w/prod equip. Set RBP @ 6800'.
11-07-87: Spotted 2 sx 10-20 sd on top of RBP. Set pkr @ 6110'. Sqzd Drinkard perfs 6423' - 6647' w/100 sx CIs "C" cmt + .3% Halad-9 followed by 100 sx CIs "C" cmt + 2% CaCl₂.
11-08 to 11-10-87: Tagged TOC @ 5900'. DO cmt to 6648'. Pres tstd sqz to 500#, held OK.
11-11-87: Circ'd sand off RBP. POH w/RBP. Acd Hare Simpson perfs 7696' - 7828' w/5000 gals 15% HCl-NEA.
11-12-87: Installed prod equip & returned well to prod.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Jerry Sexton FOR: A. J. FORE TITLE SUPERVISOR REG. & PERMITTING DATE 11-18-87
ORIGINAL SIGNED BY JERRY SEXTON DISTRICT I SUPERVISOR
APPROVED BY _____ TITLE _____ DATE _____
NOV 23 1987

RECEIVED

NOV 20 1987

OCD
HOBS OFFICE