

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State ☒	Fee ☐
5. State Oil & Gas Lease No.	
B-1481	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. CIL WELL ☒ CAS WELL ☐ OTHER ☐	7. Unit Agreement Name
2. Name of Operator	NORTHEAST DRINKARD UNIT
3. Address of Operator	8. Farm or Lease Name
P. O. BOX 576, HOUSTON, TX 77001 (WCK 4435)	NORTHEAST DRINKARD UNIT
4. Location of Well	9. Well No.
UNIT LETTER <u>E</u> , <u>3390</u> FEET FROM THE <u>SOUTH</u> LINE AND <u>4520</u> FEET FROM THE <u>EAST</u> LINE, SECTION <u>15</u> TOWNSHIP <u>21S</u> RANGE <u>37E</u> N.M.P.M.	603
10. Field and Pool, or Wildcat	11. County
NORTH EUNICE BLINEBRY-TUBB-DRINKARD OIL & GAS	LEA
15. Elevation (Show whether DF, RT, GR, etc.)	
3445' GR	

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data.

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANE ☐	COMMENCE DRILLING OPERATIONS ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	
OTHER ☐		OTHER <u>PB (sqzd) Wantz Abo, Log, Cmt sqz, Recomp to unitized intervals</u> ☒	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

7-14 to 7-26-88:

POH w/prod equip. Set CIRC @ 6696'. Sqzd Wantz Abo perfs 6723' - 7231' w/50 sx CIs "C" cmt + .3% Halad-9 followed by 250 sx CIs "C" Neat cmt + 50 SX CIs "C" cmt. Ran GR/CNL/CCL log from 6696' to 5000'. Ran GR/CBL from 6696' to 5300' w/0# & 500# on csg. TOC @ ±5700'. Perf sqz holes @ 5670' (4 JSF). Couldn't pmp thru perfs. Spot 84 gals 15% HCl across perfs @ 5670'. Acid perfs @ 5670' w/336 gals 15% HCl. Set CIRC @ 5648'. Sqzd w/50 sx CIs "C" cmt + .3% Halad-9 followed by 50 SX CIs "C" cmt + 2% CaCl₂. Ran temp survey. TOC @ 5115'. Do CIRC & 22' hard cmt. CO to PBTD @ 6696'. Pres tst'd sqz to 500# for 15 min, held OK. Perf'd Blinebry/Tubb/Drinkard 5715' - 6677' (1 JSF). Acid Drinkard perfs 6535' - 6677' w/5250 gals 15% HCl. Set RBP @ 6350'. Acid Blinebry/Tubb perfs 5715' - 6080' w/7350 gals 15% HCl. POH w/RBP. Installed prod equip & ret'd well to prod.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Marcus Winder for A. J. FORE TITLE SUPERVISOR REG. & PERMITTING DATE 8-5-88

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

AUG 12 '88

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

Z A wantz abo 8/10/88 E

RECEIVED

AUG 10 1988

OCD
HOBBS OFFICE