

MEYER B-4 #27
RECOMMENDATION TO TEMP ABANDON

This well is currently inactive. It is recommended the well be temporarily abandoned while being evaluated use as potential water flood support.

Prepare well bore as follows:

1. POH with 3555' (113 jts) of 2-3/8" tubing.
2. Make scraper run inside 5.5", 14# casing to top perf of 2569'.
3. Set Cast Iron Bridge Plug at 2519' and spot 35' of cement on top of CIBP.
4. Circulate casing with inhibited packer fluid.
5. Pressure test casing to 500# for 30 minutes. Give BLM 24 hrs notice prior to pressure test.