

Workover Procedure

S. J. Sarkeys #5

Page 2

6. RU circ equipment & TIH w/4-3/4" bit and DCs on 2-3/8" tbg. DO cmt & pressure test squeezed perms t/1000 psi. CO hole t/RBP @ ±6600'. Circ hole clean. TOH w/bit.
7. TIH w/2-3/8" tbg and retrieving tool & retrieve RBP. POOH.
8. RIH w/CA as pulled & complete as single Abo well.

S. M. Stash

S. M. Stash

KDK 7/21/87

K. D. Krawietz

D. R. McKelvey

D. R. McKelvey

G. D. Kimbrough

G. D. Kimbrough

7-22-87

RECEIVED

SEP 3

1967

OCD

HOBBS OFFICE