				ns. Division
Form 3160-5 June 1990)	DEPARTMENT C	ITED STATES	1625 French Dr. form Approved Budget Bureau No. 1004-01 Hobbs, NM 88240 Expires: March 31, 1993	
	BUREAU	J OF LAND MANAGEMENT		5. Lease Designation and Serial No NM-0634-C
Do not us	se this form for proposals	ICES AND REPORTS ON WELLS to drill or to deepen or reentry to N FOR PERMIT-" for such prop	o a different reservoi	6 If Indian Allottee or Tribe Name
<u> </u>	SUE	BMIT IN TRIPLICATE	<u></u>	7. If Unit or CA, Agreement Design
1. Type of We				
2. Name of O				8. Well Name and No. Wilshire Federal # 3
	rne Oil Company			9. API Well No.
3. Address and Telephone No.				30-025-239
P.O. Box 5270 Hobbs, NM 88241 (505)393-5905 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 1980' FSL & 990' FEL , Sec.30,T-20S, R-39E				10. Field and Pool, or Exploratory A
				D-K Abo
				11. County or Parish, State
				Lea County, New Mexico
12.	·	OX(s) TO INDICATE NATURE OF	· · · ·	
	TYPE OF SUBMISSION		TYPE OF ACTION	
	Notice of Intent	Abandonment Recompletion		Change of Plans  New Construction
	Subsequent Report	Plugging Back		Non-Routine Fracturing
	· · ·			Water Shut-Off
	. Final Abandonment Notice	Altering Casing		Conversion to Injection
directiona 04/05/2001 04/06/2001 6550'. Dum	ally drilled, give subsurface locations an MIRU Marrs Pulling Unit. Unseat Pun RU Rod tongs and continue LD Rods. up 35' cement on plug. SD due to high v	ND wellhead and NU BOP. Unset 4 1/2" pkr. PC vinds. Shut down over weekend.	iders and zones pertinent to thi DOH w/ tbg. MIRU Marrs Wireli	s work.)* ne Truck. RIH w/ 4 1/2" CIBP and set @
directiona 04/05/2001 04/06/2001 6550'. Dum 04/09/2001 success)Ri 04/10/2001 TIH and tag 11.6# casin 04/11/2001	ally drilled, give subsurface locations an MIRU Marrs Pulling Unit. Unseat Pun RU Rod tongs and continue LD Rods. p 35' cement on plug. SD due to high v RIH w/ 2 3/8" tbg to 6500' and circ. 9.4 IH w/ tbg to 3600' and spot 25 sxs ceme RIH w/ nitro and cut 4 1/2" casing @ 1 g cement @ 1340'. RIH w/ nitro and cut 19. TIH to 400' w/ tbg and spot 25 sxs c RIH w/ slickline and tag cement @ 220 peration.) LD rest of tubing. P& A Wilsh	learly state all pertinet details, and give pertinent d measured and true vertical depths for all mark np & LD Rods. SWI Overnight. ND wellhead and NU BOP. Unset 4 1/2" pkr. PC vinds. Shut down over weekend. 5# mud. POOH w/ tbg laying down 50 joints. RIH ent. POOH w/ tbg(LD all but 1700' in derrick). SI 0 1685'. (No movement) Attempt to pump into w/ no casing @ 300'. Attempt to establish a injection r ement inside stub of casing.SI Overnight. D'.TOH w/ wire and pickup 2 joints of tbg and spo hire Federal # 3 @ 9:00AM 4/11/2001. Set dry hol	ders and zones pertinent to thi DOH w/ tbg. MIRU Marrs Wireli w/ nitro and cut csg @ 3514' ( Overnight. o success.TIH to 1795 and spo ate but began pumping casing of 10sxs cement @ 60'.(Steve C le marker. Remove anchors & t	(Note: Report results of multiple completion on W Completion or Recompletion Report and Log form the of starting any proposed work. If well is s work.)* ne Truck. RIH w/ 4 1/2" CIBP and set @ No Movement) Attempt to pump into.(no t 25sxs cement.TOH and wait 2 1/2 hou out of hole. RU and laydown 9 joints of 4 Caffey w/ BLM & Terry Burke w/ MOC witt empty reserve pit and remove liner. RDI
directiona 04/05/2001 04/06/2001 6550'. Dum 04/09/2001 success)RI 04/10/2001 TIH and tag 11.6# casin 04/11/2001 all above of Marr's Equi	ally drilled, give subsurface locations an MIRU Marrs Pulling Unit. Unseat Pun RU Rod tongs and continue LD Rods. np 35' cement on plug. SD due to high v RIH w/ 2 3/8" tbg to 6500' and circ. 9.4 H w/ tbg to 3600' and spot 25 sxs ceme RIH w/ nitro and cut 4 1/2" casing @ 1 g cement @ 1340'. RIH w/ nitro and cut ng. TIH to 400' w/ tbg and spot 25 sxs c RIH w/ slickline and tag cement @ 220 peration.) LD rest of tubing. P& A Wilsh ipment.	learly state all pertinet details, and give pertinent of measured and true vertical depths for all mark on the state and true vertical depths for all mark on the state and true vertical depths for all mark on the state and true vertical depths for all mark on the state and true vertical depths for all mark of the state and true vertical depths for all mark of the state and NU BOP. Unset 4 1/2" pkr. PC vinds. Shut down over weekend. 5# mud. POOH w/ tbg laying down 50 joints. RIH ent. POOH w/ tbg laying	ders and zones pertinent to thi DOH w/ tbg. MIRU Marrs Wireli w/ nitro and cut csg @ 3514' ( Overnight. o success.TIH to 1795 and spo ate but began pumping casing ot 10sxs cement @ 60'.(Steve C	(Note: Report results of multiple completion on W Completion or Recompletion Report and Log form the of starting any proposed work. If well is s work.)* ne Truck. RIH w/ 4 1/2" CIBP and set @ No Movement) Attempt to pump into.(no t 25sxs cement.TOH and wait 2 1/2 hou out of hole. RU and laydown 9 joints of 4 Caffey w/ BLM & Terry Burke w/ MOC witt empty reserve pit and remove liner. RDI
directiona 04/05/2001 04/06/2001 6550'. Dum 04/09/2001 success)RI 04/10/2001 TIH and tag 11.6# casin 04/11/2001 all above of Marr's Equi	ally drilled, give subsurface locations an MIRU Marrs Pulling Unit. Unseat Pun RU Rod tongs and continue LD Rods. p 35' cement on plug. SD due to high v RIH w/ 2 3/8" tbg to 6500' and circ. 9.4 IH w/ tbg to 3600' and spot 25 sxs ceme RIH w/ nitro and cut 4 1/2" casing @ 1 g cement @ 1340'. RIH w/ nitro and cut 19. TIH to 400' w/ tbg and spot 25 sxs c RIH w/ slickline and tag cement @ 220 peration.) LD rest of tubing. P& A Wilsh	learly state all pertinet details, and give pertinent of measured and true vertical depths for all mark on the state and true vertical depths for all mark on the state and true vertical depths for all mark on the state and true vertical depths for all mark on the state and true vertical depths for all mark of the state and true vertical depths for all mark of the state and NU BOP. Unset 4 1/2" pkr. PC vinds. Shut down over weekend. 5# mud. POOH w/ tbg laying down 50 joints. RIH ent. POOH w/ tbg laying	ders and zones pertinent to thi DOH w/ tbg. MIRU Marrs Wireli w/ nitro and cut csg @ 3514' ( Overnight. o success.TIH to 1795 and spo ate but began pumping casing of 10sxs cement @ 60'. (Steve C le marker. Remove anchors & the le marker. Remove anchors & the le marker. Remove anchors & the	(Note: Report results of multiple completion on W Completion or Recompletion Report and Log for the of starting any proposed work. If well is s work.)* ne Truck. RIH w/ 4 1/2" CIBP and set @ No Movement) Attempt to pump into.(no t 25sxs cement.TOH and wait 2 1/2 hou out of hole. RU and laydown 9 joints of 4 Caffey w/ BLM & Terry Burke w/ MOC wite empty reserve pit and remove liner. RDI
directiona 04/05/2001 04/06/2001 6550'. Dum 04/09/2001 success)RI 04/10/2001 TIH and tag 11.6# casin 04/11/2001 all above op Marr's Equi	ally drilled, give subsurface locations an MIRU Marrs Pulling Unit. Unseat Pun RU Rod tongs and continue LD Rods. np 35' cement on plug. SD due to high v RIH w/ 2 3/8" tbg to 6500' and circ. 9.4 H w/ tbg to 3600' and spot 25 sxs ceme RIH w/ nitro and cut 4 1/2" casing @ 1 g cement @ 1340'. RIH w/ nitro and cut ng. TIH to 400' w/ tbg and spot 25 sxs c RIH w/ slickline and tag cement @ 220 peration.) LD rest of tubing. P& A Wilsh ipment.	learly state all pertinet details, and give pertinent ad measured and true vertical depths for all mark on the state and true vertical depths for all mark on the state and true vertical depths for all mark on the state and true vertical depths for all mark on the state and true vertical depths for all mark of the state and true vertical depths for all mark of the state and NU BOP. Unset 4 1/2" pkr. PC vinds. Shut down over weekend. 5# mud. POOH w/ tbg laying down 50 joints. RIH ent. POOH w/ tbg laying	ders and zones pertinent to thi DOH w/ tbg. MIRU Marrs Wireli w/ nitro and cut csg @ 3514' ( Overnight. o success.TIH to 1795 and spo ate but began pumping casing of 10sxs cement @ 60'. (Steve C le marker. Remove anchors & the le marker. Remove anchors & the le marker. Remove anchors & the	(Note: Report results of multiple completion on W Completion or Recompletion Report and Log form are of starting any proposed work. If well is s work.)* ne Truck. RIH w/ 4 1/2" CIBP and set @ No Movement) Attempt to pump into.(no t 25sxs cement.TOH and wait 2 1/2 hou out of hole. RU and laydown 9 joints of 4 Caffey w/ BLM & Terry Burke w/ MOC wit empty reserve pit and remove liner. RDI
directiona 04/05/2001 04/06/2001 6550'. Dum 04/09/2001 Success)RI 04/10/2001 TIH and tag 11.6# casin 04/11/2001 all above op Marr's Equi	ally drilled, give subsurface locations an MIRU Marrs Pulling Unit. Unseat Pun RU Rod tongs and continue LD Rods. p 35' cement on plug. SD due to high v RIH w/ 2 3/8" tbg to 6500' and circ. 9.9 IH w/ tbg to 3600' and spot 25 sxs ceme RIH w/ nitro and cut 4 1/2" casing @ 1 g cement @ 1340'. RIH w/ nitro and cut ng. TIH to 400' w/ tbg and spot 25 sxs c RIH w/ slickline and tag cement @ 220 peration.) LD rest of tubing. P& A Wilsh ipment.	Idearly state all pertinet details, and give pertinent ind measured and true vertical depths for all mark inp & LD Rods. SWI Overnight. ND wellhead and NU BOP. Unset 4 1/2" pkr. PC vinds. Shut down over weekend. 5# mud. POOH w/ tbg laying down 50 joints. RIH ent. POOH w/ tbg(LD all but 1700' in derrick). Still 1685'. (No movement) Attempt to pump into w/ no casing @ 300'. Attempt to establish a injection r ement inside stub of casing.SI Overnight. D'.TOH w/ wire and pickup 2 joints of tbg and spo hire Federal # 3 @ 9:00AM 4/11/2001. Set dry hol Surface re rect 	ders and zones pertinent to thi DOH w/ tbg. MIRU Marrs Wireli w/ nitro and cut csg @ 3514' ( Overnight. o success.TIH to 1795 and spo ate but began pumping casing of 10sxs cement @ 60'. (Steve C le marker. Remove anchors & the le marker. Remove anchors & the le marker. Remove anchors & the	(Note: Report results of multiple completion on M Completion or Recompletion Report and Log for e of starting any proposed work. If well is s work.)* ne Truck. RIH w/ 4 1/2" CIBP and set @ No Movement) Attempt to pump into.(no t 25sxs cement.TOH and wait 2 1/2 hou out of hole. RU and laydown 9 joints of 4 Caffey w/ BLM & Terry Burke w/ MOC wit empty reserve pit and remove liner. RDI
directiona 04/05/2001 04/06/2001 6550'. Dum 04/09/2001 success)RI 04/10/2001 TIH and tag 11.6# casin 04/11/2001 all above op Marr's Equi 14. I hereby of Signed (This space Approved by Conditions of	ally drilled, give subsurface locations an MIRU Marrs Pulling Unit. Unseat Pun RU Rod tongs and continue LD Rods. ap 35' cement on plug. SD due to high v RIH w/ 2 3/8" tbg to 6500' and circ. 9.9 IH w/ tbg to 3600' and spot 25 sxs ceme RIH w/ nitro and cut 4 1/2" casing @ 1 g cement @ 1340'. RIH w/ nitro and cut 1g. TIH to 400' w/ tbg and spot 25 sxs c RIH w/ slickline and tag cement @ 220 peration.) LD rest of tubing. P& A Wilsh ipment.	Idearly state all pertinet details, and give pertinent Id measured and true vertical depths for all mark np & LD Rods. SWI Overnight. ND wellhead and NU BOP. Unset 4 1/2" pkr. PC vinds. Shut down over weekend. 5# mud. POOH w/ tbg laying down 50 joints. RIH ent. POOH w/ tbg(LD all but 1700' in derrick). SI 1685'. (No movement) Attempt to pump into w/ no casing @ 300'. Attempt to establish a injection r ement inside stub of casing.SI Overnight. D'.TOH w/ wire and pickup 2 joints of tbg and spo irre Federal # 3 @ 9:00AM 4/11/2001. Set dry hol Surface re Title Drig Foreman Title Title Drig Foreman Title Title	ders and zones pertinent to thi DOH w/ tbg. MIRU Marrs Wireli w/ nitro and cut csg @ 3514' ( Overnight. o success.TIH to 1795 and spo rate but began pumping casing of 10sxs cement @ 60'. (Steve C le marker. Remove anchors & to holer bond is retained un siteration is competed.	(Note: Report results of multiple completion on W Completion or Recompletion Report and Log form are of starting any proposed work. If well is s work.)* ne Truck. RIH w/ 4 1/2" CIBP and set @ No Movement) Attempt to pump into.(no t 25sxs cement.TOH and wait 2 1/2 hou out of hole. RU and laydown 9 joints of 4 Caffey w/ BLM & Terry Burke w/ MOC wite empty reserve pit and remove liner. RDF Date 04/25/01
directiona 04/05/2001 04/06/2001 6550'. Dum 04/09/2001 success)RI 04/10/2001 TIH and tag 11.6# casin 04/11/2001 all above op Marr's Equi 14. I hereby of Signed (This space Approved by Conditions of	ally drilled, give subsurface locations an MIRU Marrs Pulling Unit. Unseat Pun RU Rod tongs and continue LD Rods. np 35' cement on plug. SD due to high v RIH w/ 2 3/8" tbg to 6500' and circ. 9.4 HW w/ 100 and spot 25 sxs ceme RIH w/ nitro and cut 4 1/2" casing @ 1 g cement @ 1340'. RIH w/ nitro and cut ng. TiH to 400' w/ tbg and spot 25 sxs c RIH w/ slickline and tag cement @ 220 peration.) LD rest of tubing. P& A Wilsh ipment.	Idearly state all pertinet details, and give pertinent Id measured and true vertical depths for all mark np & LD Rods. SWI Overnight. ND wellhead and NU BOP. Unset 4 1/2" pkr. PC vinds. Shut down over weekend. 5# mud. POOH w/ tbg laying down 50 joints. RIH ent. POOH w/ tbg(LD all but 1700' in derrick). SI 1685'. (No movement) Attempt to pump into w/ no casing @ 300'. Attempt to establish a injection r ement inside stub of casing.SI Overnight. D'.TOH w/ wire and pickup 2 joints of tbg and spo irre Federal # 3 @ 9:00AM 4/11/2001. Set dry hol Surface re Title Drig Foreman Title Title Drig Foreman Title Title	department or agency of the U	(Note: Report results of multiple completion on W Completion or Recompletion Report and Log form are of starting any proposed work. If well is s work.)* ne Truck. RIH w/ 4 1/2" CIBP and set @ No Movement) Attempt to pump into.(no t 25sxs cement.TOH and wait 2 1/2 hou out of hole. RU and laydown 9 joints of 4 Caffey w/ BLM & Terry Burke w/ MOC wite empty reserve pit and remove liner. RDF Date 04/25/01
directiona 04/05/2001 04/06/2001 6550'. Dum 04/09/2001 success)RI 04/10/2001 TIH and tag 11.6# casin 04/11/2001 all above op Marr's Equi 14. I hereby of Signed (This space Approved by Conditions of	ally drilled, give subsurface locations an MIRU Marrs Pulling Unit. Unseat Pun RU Rod tongs and continue LD Rods. ap 35' cement on plug. SD due to high v RIH w/ 2 3/8" tbg to 6500' and circ. 9.9 IH w/ tbg to 3600' and spot 25 sxs ceme RIH w/ nitro and cut 4 1/2" casing @ 1 g cement @ 1340'. RIH w/ nitro and cut 1g. TIH to 400' w/ tbg and spot 25 sxs c RIH w/ slickline and tag cement @ 220 peration.) LD rest of tubing. P& A Wilsh ipment.	Idearly state all pertinet details, and give pertinent Id measured and true vertical depths for all mark np & LD Rods. SWI Overnight. ND wellhead and NU BOP. Unset 4 1/2" pkr. PC vinds. Shut down over weekend. 5# mud. POOH w/ tbg laying down 50 joints. RIH ent. POOH w/ tbg(LD all but 1700' in derrick). SI 1685'. (No movement) Attempt to pump into w/ no casing @ 300'. Attempt to establish a injection r ement inside stub of casing.SI Overnight. D'.TOH w/ wire and pickup 2 joints of tbg and spo irre Federal # 3 @ 9:00AM 4/11/2001. Set dry hol Surface re Title Drlg Foreman Title Title	department or agency of the U	(Note: Report results of multiple completion on W Completion or Recompletion Report and Log form are of starting any proposed work. If well is s work.)* ne Truck. RIH w/ 4 1/2" CIBP and set @ No Movement) Attempt to pump into.(no t 25sxs cement.TOH and wait 2 1/2 hou out of hole. RU and laydown 9 joints of 4 Caffey w/ BLM & Terry Burke w/ MOC wite empty reserve pit and remove liner. RDF Date 04/25/01